

## General Information

Date & Time: 04, Oct, 2025 18:09

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	16,686
<b>Registration No.</b>	NHQ4893	<b>Chassis No.</b>	PA1B18F32R232823
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



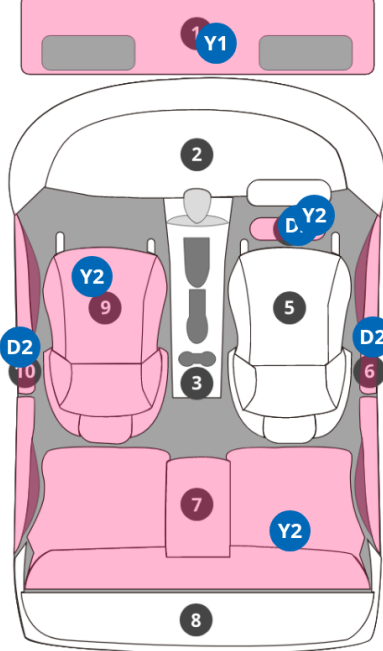
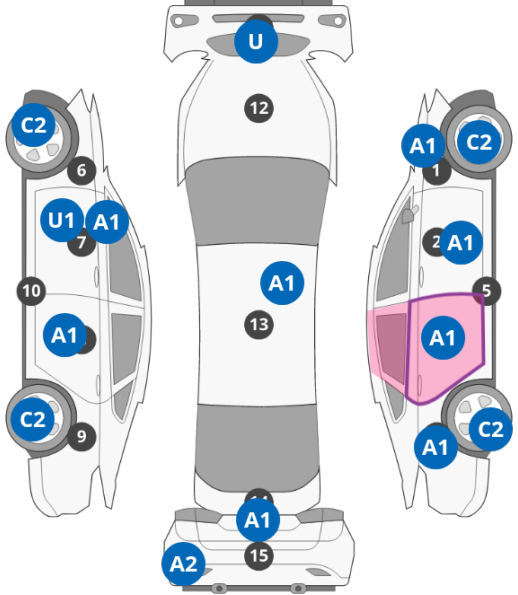
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	114	113	111
2	Boot Lid	105.0	106	103	106
3	Roof	97.5	97	104	92/97
4	Left Front Fender	97.0	99	98	94
5	Left Front Door	101.7	100	107	98
6	Center Panel Left				
7	Left Rear Door	102.2	106	105	96
8	Left Back Panel	107.6	111	106	106
9	Right Front Fender	99.7	104	100	95
10	Right Front Door	103.8	105	107	100
11	Center Panel Right				
12	Right Rear Door	146.0	142	143	153
13	Right Back Panel	110.3	113	110	108

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Mat Other - Grime - Small / (R) Front Trim - Worked - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Dent - Minimal / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate, No warranty booklet and Sparetire and Jack and Tools, No spare key and scratch headlight and tail light, Worn Tires and scratch wheels.</p>