

## General Information

Date & Time: 06, Oct, 2025 16:08

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	16,355
<b>Registration No.</b>	CCJ3234	<b>Chassis No.</b>	PA1B18F31R4279443
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blackish Red Mica		

## Body / Panel Condition



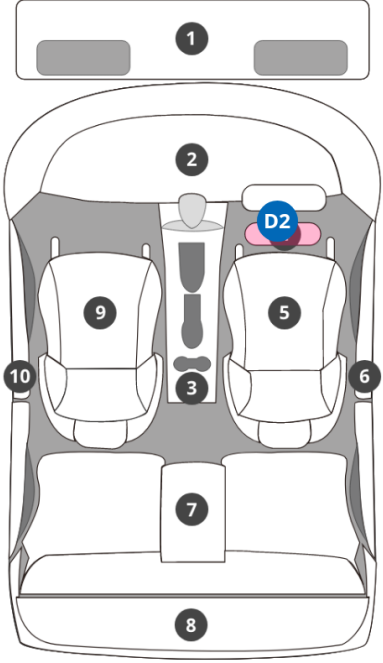
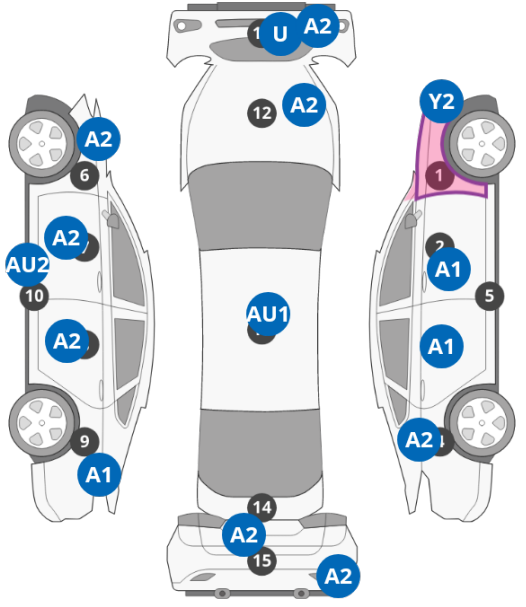
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.3	104	96	98
2	Boot Lid	108.2	105	97	123
3	Roof	98.2	94	104	89/106
4	Left Front Fender	100.3	100	99	102
5	Left Front Door	103.0	103	103	103
6	Center Panel Left				
7	Left Rear Door	104.3	107	100	106
8	Left Back Panel	107.5	126	103	94
9	Right Front Fender	266.3	243	295	261
10	Right Front Door	109.0	105	114	108
11	Center Panel Right				
12	Right Rear Door	110.6	107	114	111
13	Right Back Panel	116.0	106	113	129

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>A</b>	<b>Exterior Evaluation :</b>	<b>B</b>
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small</p>		<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Crack, Gap - Small / Bonnet, Headlight - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small</p>	
<b>Frame Evaluation :</b>	<b>A</b>	<b>Functional Evaluation :</b>	<b>A</b>
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Defects not found</p>	

## Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light.