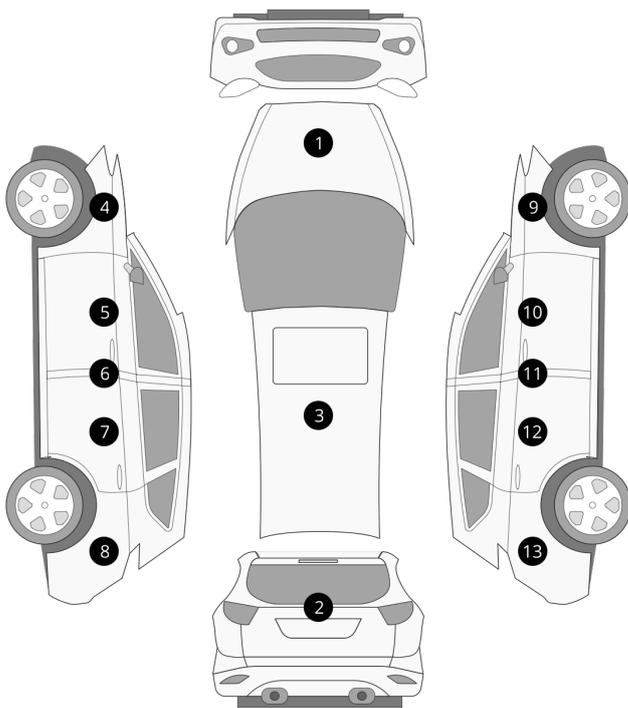


## General Information

Date & Time: 06, Oct, 2025 13:42

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	258,308
<b>Registration No.</b>	DAG1957	<b>Chassis No.</b>	PA2GW8EM7H3152178
<b>CC</b>	2.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



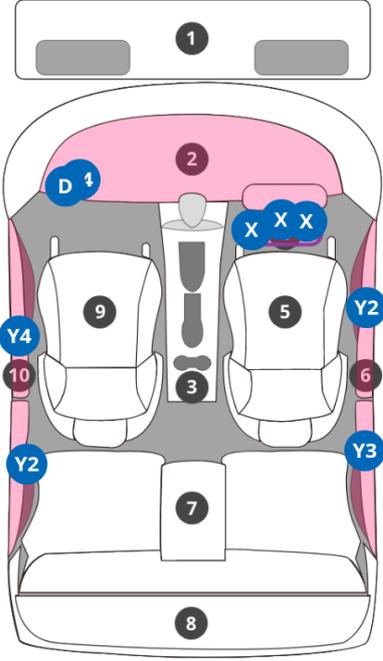
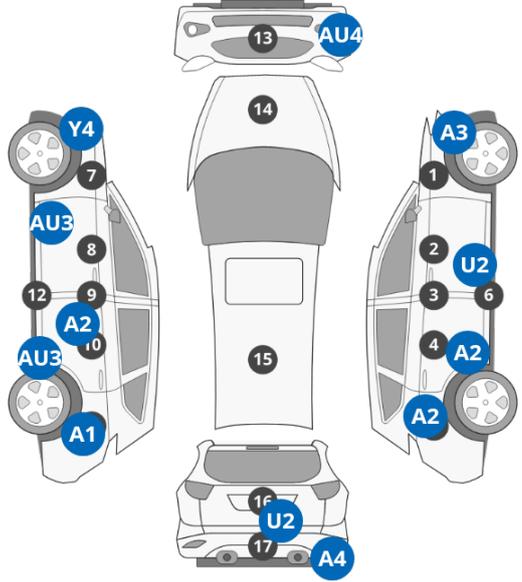
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	259.3	272	244	262
2	Boot Lid	139.3	137	135	146
3	Roof	123.7	127	124	121/123
4	Left Front Fender	128.6	131	134	121
5	Left Front Door	116.0	119	112	117
6	Center Panel Left				
7	Left Rear Door	116.6	120	112	118
8	Left Back Panel	131.0	130	129	134
9	Right Front Fender	125.6	123	131	123
10	Right Front Door	119.6	121	118	120
11	Center Panel Right				
12	Right Rear Door	120.6	117	117	128
13	Right Back Panel	130.6	127	133	132

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>          Steering Wheel - Worn, Peel, Crack - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Trim - Grime - Large / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b>          (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Crack, Gap - Large / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b>          Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b>          Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>possible flooding/ no warranty booklet/ plate light issue/ radio issue/ with jack and spare tire/ with tools and LTO plate/</p>