

General Information

Date & Time: 18, Nov, 2025 19:42

| | | | |
|-------------------------|-------------------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2023 | Odo Meter Reading | 24,577 |
| Registration No. | FAQ2064 | Chassis No. | PA1B18F3XP4225409 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Red Mica Metallic | | |

Body / Panel Condition



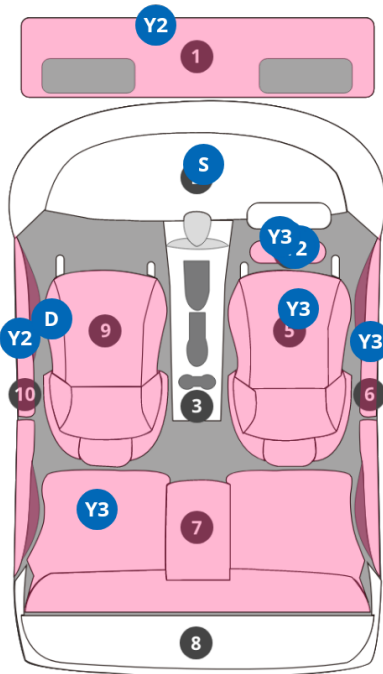
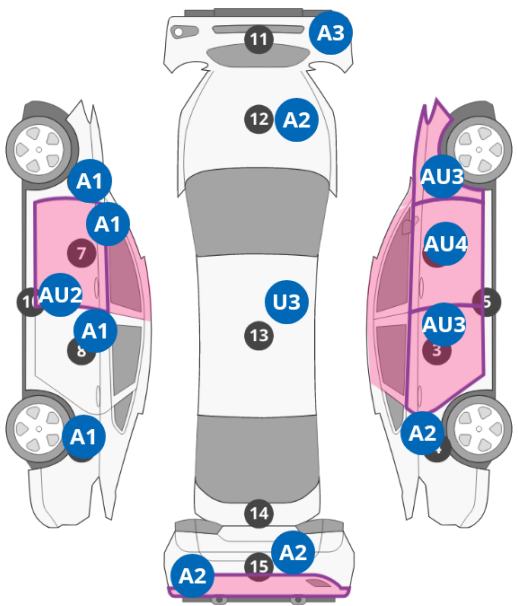
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 119.6 | 120 | 121 | 118 |
| 2 | Boot Lid | 118.3 | 114 | 120 | 121 |
| 3 | Roof | 111.5 | 109 | 107 | 120/110 |
| 4 | Left Front Fender | 334.3 | 108 | 105 | 790 |
| 5 | Left Front Door | 105.6 | 100 | 102 | 115 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 123.6 | 150 | 115 | 106 |
| 8 | Left Back Panel | 121.3 | 126 | 111 | 127 |
| 9 | Right Front Fender | 110.3 | 110 | 116 | 105 |
| 10 | Right Front Door | 105.0 | 109 | 102 | 104 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 110.0 | 107 | 111 | 112 |
| 13 | Right Back Panel | 109.8 | 111 | 99 | 119 |

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|--|
| Interior Evaluation : D | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| Remarks Overall Interior - Smell - Yes / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Mat Other - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes | Remarks (L) Front Fender - Repair Traces - Yes / Roof - Dent - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium |
| Frame Evaluation : A | Functional Evaluation : B |
| Remarks Defects not found | Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes |

| |
|---|
| Inspector Notes |
| with warranty booklet, with jack, incomplete tools, with spare tire, no LTO plate, possible flooding, scratches on headlight and tail light, horn issue |