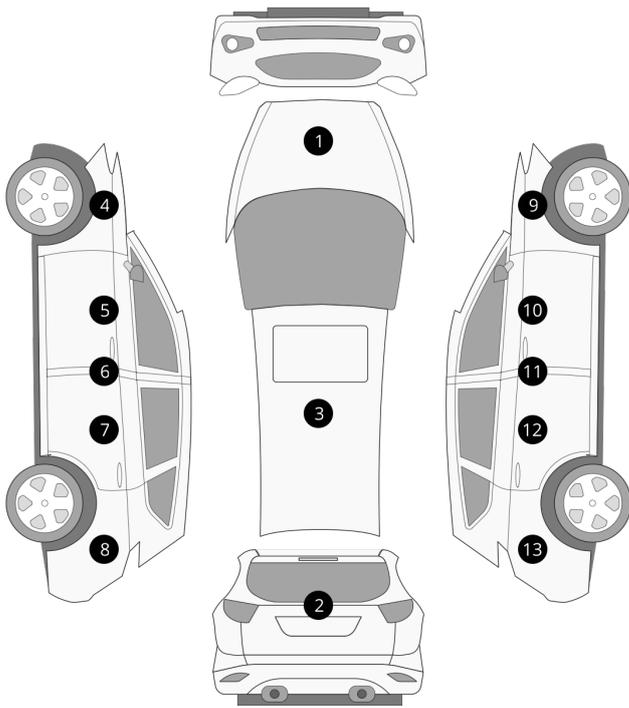


## General Information

Date & Time: 17, Oct, 2025 16:49

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	29,224
<b>Registration No.</b>	Z5O914	<b>Chassis No.</b>	PA1B18F33P4218527
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



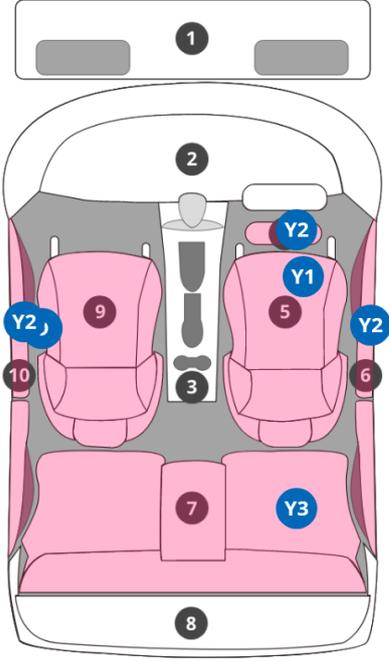
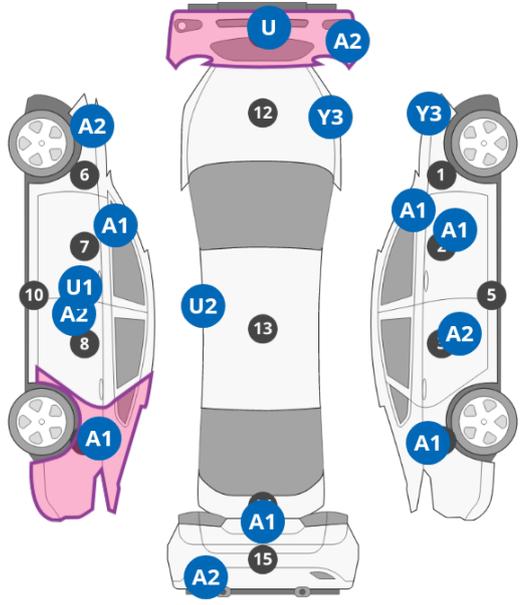
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	122	111	106
2	Boot Lid	108.3	100	102	123
3	Roof	96.4	101	95	101/89
4	Left Front Fender	100.7	103	98	101
5	Left Front Door	91.8	92	95	89
6	Center Panel Left				
7	Left Rear Door	96.0	93	94	101
8	Left Back Panel	108.6	101	110	115
9	Right Front Fender	173.0	165	162	192
10	Right Front Door	112.3	126	107	104
11	Center Panel Right				
12	Right Rear Door	210.6	218	212	202
13	Right Back Panel	214.3	180	210	253

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Crack, Gap - Medium / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack, no tools, with spare tire, no LTO plate, scratches on headlight and tail light</p>