

## General Information

Date & Time: 19, Jan, 2026 09:45

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	1,527
<b>Registration No.</b>	GBE7079	<b>Chassis No.</b>	PA1B18F35R4257140
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



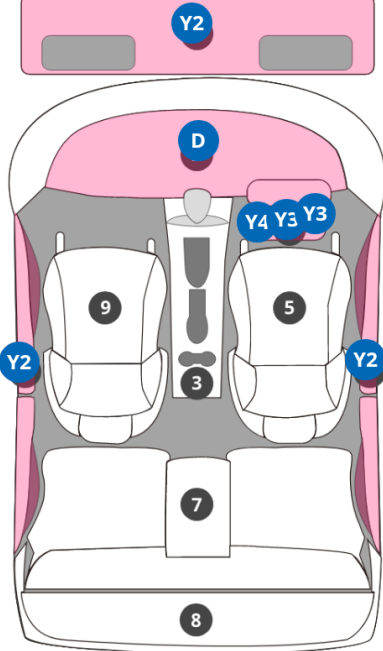
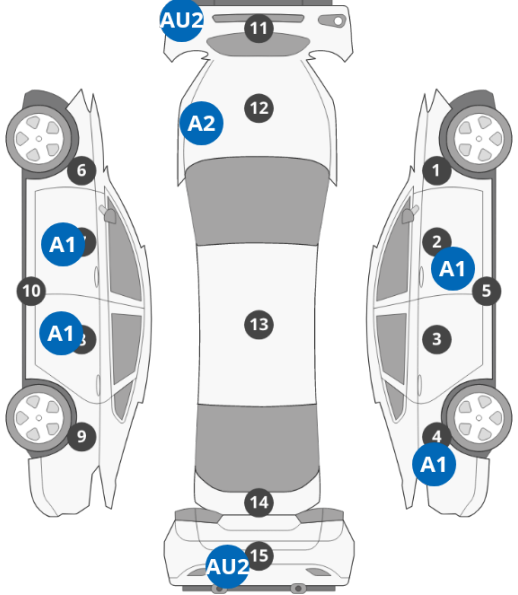
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	110	112	115
2	Boot Lid	109.0	111	113	103
3	Roof	102.9	107	106	98/101
4	Left Front Fender	96.7	104	92	94
5	Left Front Door	102.3	104	103	100
6	Center Panel Left				
7	Left Rear Door	104.2	114	105	94
8	Left Back Panel	110.6	119	106	107
9	Right Front Fender	102.6	104	98	106
10	Right Front Door	101.0	104	93	106
11	Center Panel Right				
12	Right Rear Door	112.0	107	109	120
13	Right Back Panel	114.6	116	108	120

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Grime - Large / (L) Front Trim - Grime - Small / Ceiling - Grime - Small / Mat Other - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Steering - Issue - Yes / Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire, jack and seat cover. Incomplete tools. 3 keys. No LTO plate.</p>