

## General Information

Date & Time: 21, Nov, 2025 15:10

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	41,596
<b>Registration No.</b>	GBF1831	<b>Chassis No.</b>	PA1B18F34R4261891
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



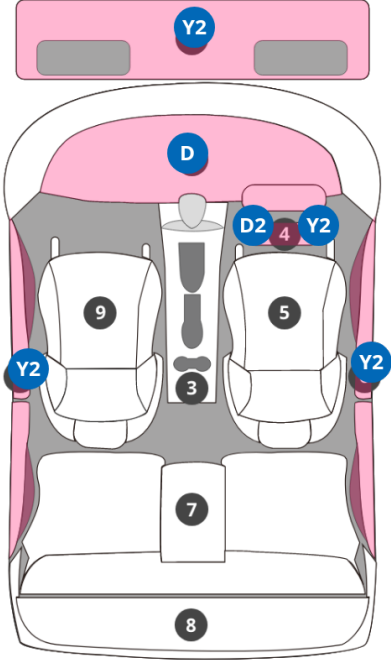
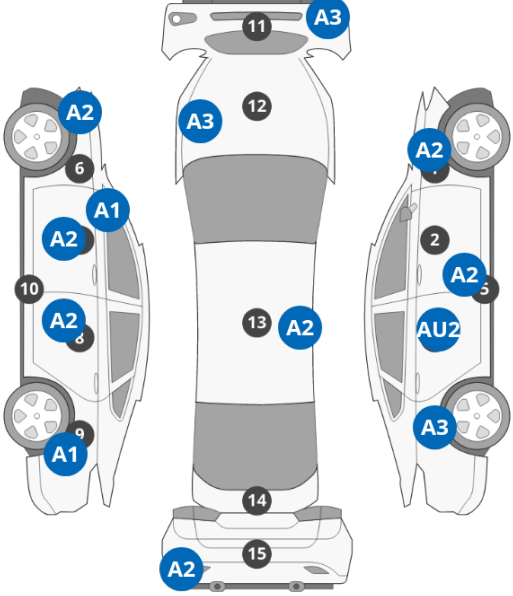
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.0	172	148	169
2	Boot Lid	166.0	162	171	165
3	Roof	150.7	149	157	143/154
4	Left Front Fender	136.6	140	134	136
5	Left Front Door	120.3	124	119	118
6	Center Panel Left				
7	Left Rear Door	150.6	162	151	139
8	Left Back Panel	158.3	179	149	147
9	Right Front Fender	141.0	148	141	134
10	Right Front Door	147.0	149	140	152
11	Center Panel Right				
12	Right Rear Door	144.3	144	144	145
13	Right Back Panel	154.0	142	152	168

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire, jack and seat cover. 3 keys. With LTO plate.</p>