

## General Information

Date & Time: 05, Nov, 2025 21:34

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	31,874
<b>Registration No.</b>	GAK3654	<b>Chassis No.</b>	PA1B18F37P4206185
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



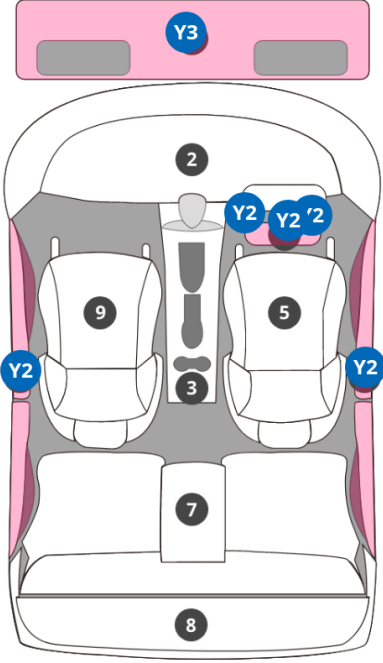
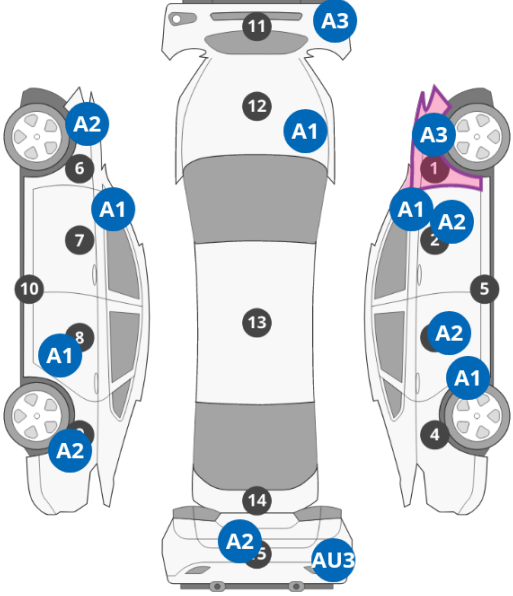
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	106	102	110
2	Boot Lid	104.6	106	106	102
3	Roof	90.4	93	91	85/93
4	Left Front Fender	93.2	94	93	92
5	Left Front Door	100.1	96	105	99
6	Center Panel Left				
7	Left Rear Door	98.6	96	96	104
8	Left Back Panel	104.3	111	100	102
9	Right Front Fender	94.9	92	99	94
10	Right Front Door	97.0	94	96	101
11	Center Panel Right				
12	Right Rear Door	100.0	100	98	102
13	Right Back Panel	98.0	92	100	102

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Front Wheel, Cover - Cap Missing - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>One extra warranty booklet, misplaced in this unit. With 2 warranty booklet, spare tire, jack and seat cover. Without tools. 3 keys. NO LTO plate.</p>