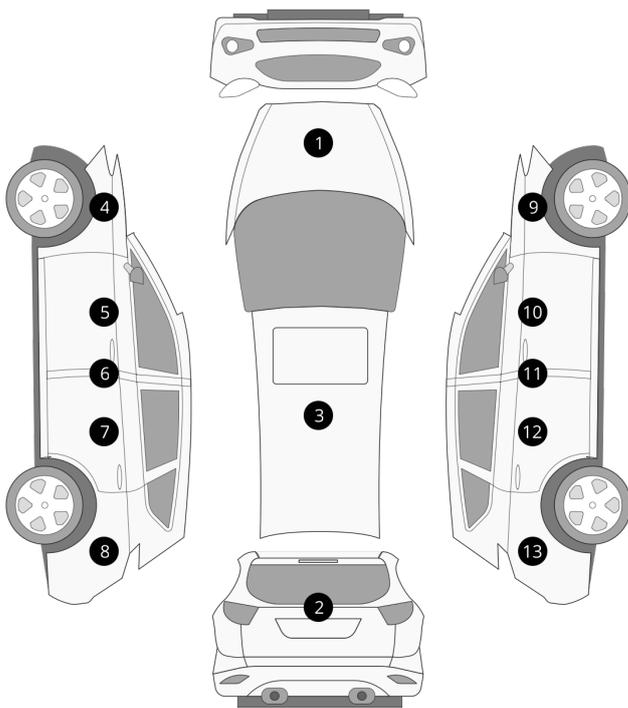


## General Information

Date & Time: 14, Nov, 2025 10:15

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	19,272
<b>Registration No.</b>	HAG7405	<b>Chassis No.</b>	MHFAA1BY0P0019432
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	White		

## Body / Panel Condition



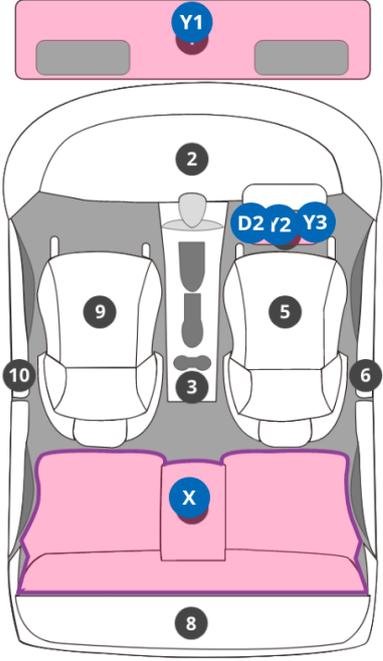
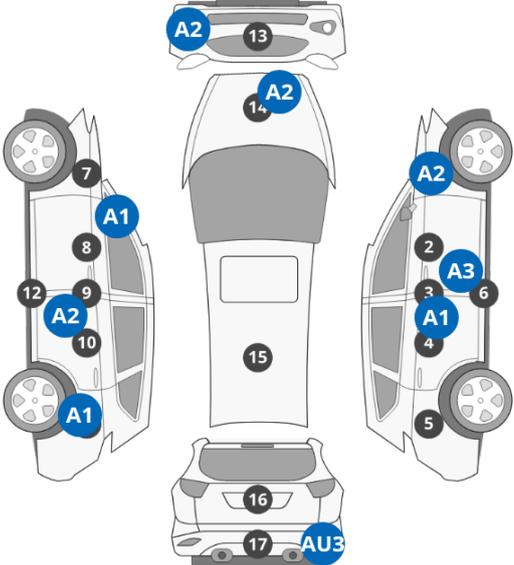
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.9	83	80	86
2	Boot Lid	85.3	87	86	83
3	Roof	107.2	98	96	127/108
4	Left Front Fender	93.6	93	93	95
5	Left Front Door	102.0	98	94	114
6	Center Panel Left				
7	Left Rear Door	101.3	103	101	100
8	Left Back Panel	106.8	118	106	97
9	Right Front Fender	88.2	94	90	80
10	Right Front Door	107.0	116	105	100
11	Center Panel Right				
12	Right Rear Door	104.3	102	99	112
13	Right Back Panel	100.4	100	93	108

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / Rear Seat - Partially Missing - Yes / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>Maintenance warning lamp. Without warranty booklet and tools. With spare tire, jack and seat cover. 2 keys. With LTO plate.</p>