

General Information

Date & Time: 10, Oct, 2025 13:58

Make	Toyota	Model	Innova
YOM	2018	Odo Meter Reading	57,421
Registration No.	DAD3517	Chassis No.	PA2JA8EM1J0050533
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



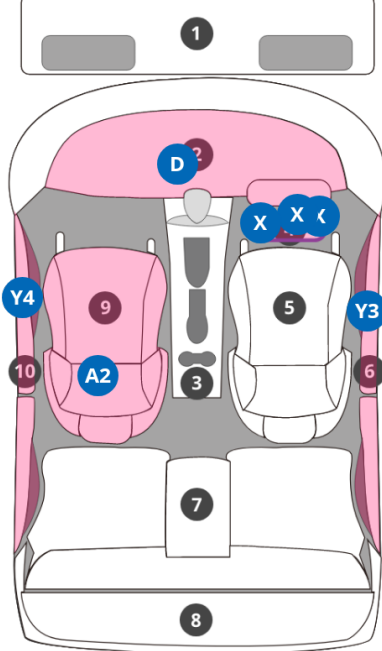
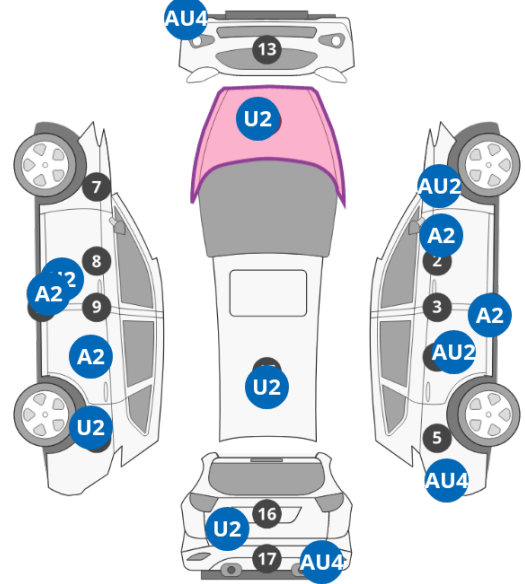
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	144.3	145	124	164
2	Boot Lid	98.8	99	91	106
3	Roof	88.4	92	85	87/89
4	Left Front Fender	614.3	131	686	1,026
5	Left Front Door	213.6	222	206	213
6	Center Panel Left				
7	Left Rear Door	166.6	162	166	172
8	Left Back Panel	296.3	201	503	185
9	Right Front Fender	603.3	799	505	506
10	Right Front Door	220.6	208	182	272
11	Center Panel Right				
12	Right Rear Door	132.0	124	131	141
13	Right Back Panel	601.6	247	504	1,054

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Dent - Small
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
headlight issue/ interior light issue/ possible flooding/ radio not working/ No tools and jack/ spare wheel only, no tire/ different wheels/ with LTO plate and warranty booklet/