

General Information

Date & Time: 09, Oct, 2025 14:48

Make	Nissan	Model	Almera
YOM	2018	Odo Meter Reading	52,329
Registration No.	NCR8747	Chassis No.	BDUALBAN17C03772
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



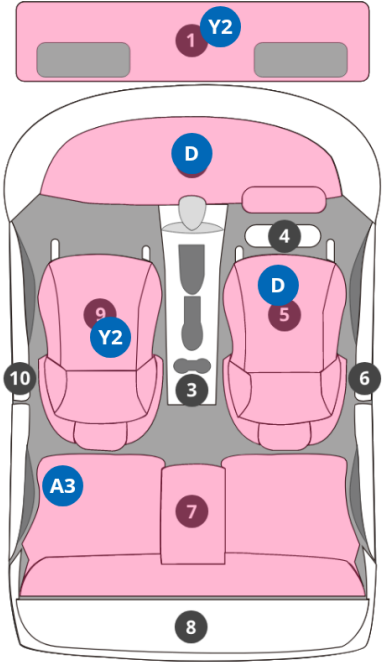
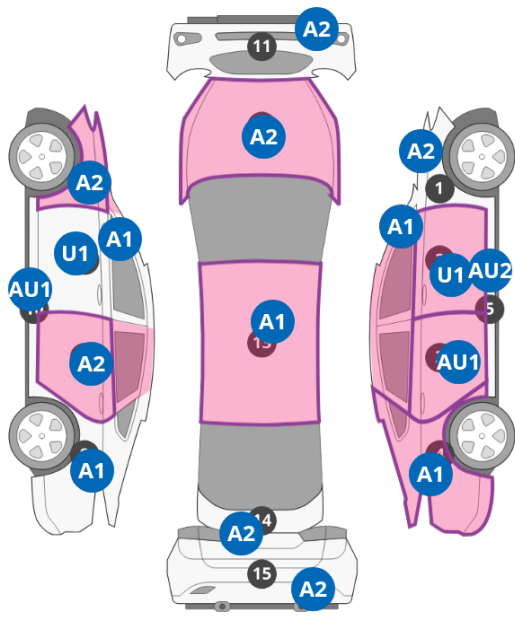
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	208.6	219	195	212
2	Boot Lid	162.0	176	161	149
3	Roof	147.5	160	146	130/154
4	Left Front Fender	149.6	146	164	139
5	Left Front Door	143.0	153	133	143
6	Center Panel Left				
7	Left Rear Door	97.7	104	90	99
8	Left Back Panel	142.6	180	132	116
9	Right Front Fender	169.3	173	172	163
10	Right Front Door	189.0	188	190	189
11	Center Panel Right				
12	Right Rear Door	204.6	207	180	227
13	Right Back Panel	226.0	214	220	244

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Cut, Crack - Medium / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Worn - Yes / (L) Front Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Dent - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With LTO plate and Sparetire, Warranty Booklet, No Tools and Jack, Scratch headlight and tail light, Worn Tires and Sparetire, No reverse camera, foul smell.