

## General Information

Date & Time: 10, Oct, 2025 16:07

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	22,533
<b>Registration No.</b>	LAL3124	<b>Chassis No.</b>	PAEA13TJPNA002802
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



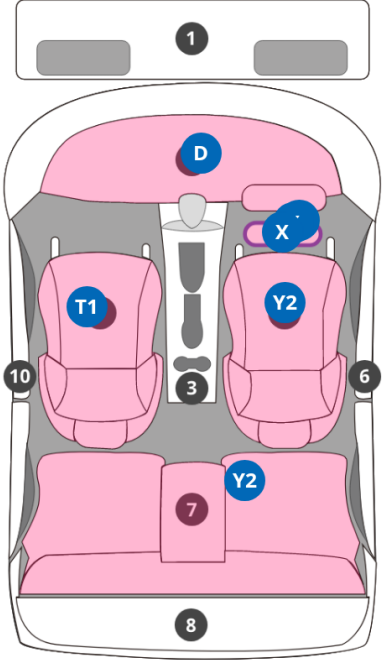
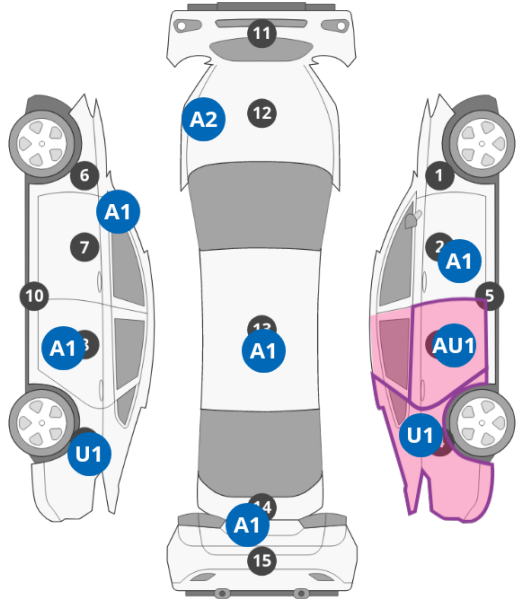
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	128	121	131
2	Boot Lid	109.8	99	114	117
3	Roof	106.2	103	105	101/116
4	Left Front Fender	120.3	130	125	106
5	Left Front Door	110.0	107	110	113
6	Center Panel Left				
7	Left Rear Door	155.3	170	144	152
8	Left Back Panel	127.3	128	126	128
9	Right Front Fender	164.6	164	169	161
10	Right Front Door	159.0	167	145	165
11	Center Panel Right				
12	Right Rear Door	177.0	182	163	186
13	Right Back Panel	327.0	484	285	212

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Cigarette Burns - Burnt Minimal</p>	<p><b>Remarks</b> (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Fender, Molding - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and warranty booklet, No Tools and Jack and Sparetire, No spare key, worn tires, adhesive marks, No reverse camera, foul smell., scratch front Windshield.</p>