

General Information

Date & Time: 13, Oct, 2025 10:39

Make	Mitsubishi	Model	Xpander
YOM	2019	Odo Meter Reading	65,241
Registration No.	DAM4684	Chassis No.	MK2XNNC1WKN004513
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



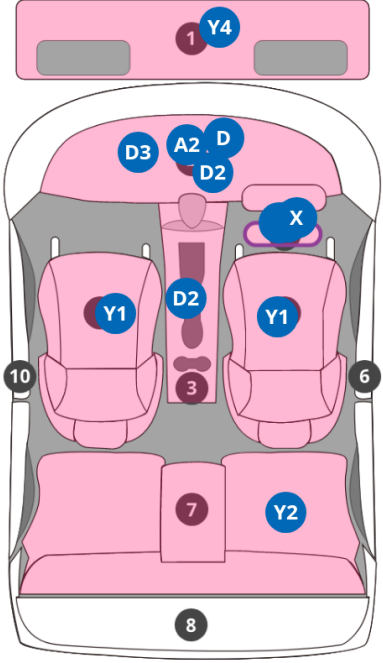
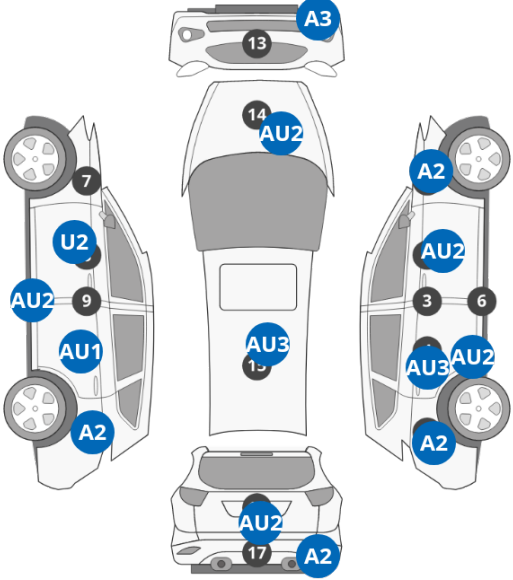
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.1	102	92	106
2	Boot Lid	96.6	97	100	93
3	Roof	99.9	104	97	97/102
4	Left Front Fender	82.5	76	86	86
5	Left Front Door	92.2	92	94	91
6	Center Panel Left				
7	Left Rear Door	96.4	98	100	92
8	Left Back Panel	96.6	95	95	100
9	Right Front Fender	88.6	89	91	86
10	Right Front Door	99.4	101	98	99
11	Center Panel Right				
12	Right Rear Door	98.9	99	98	100
13	Right Back Panel	106.4	98	112	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Dashboard - Loose, Deformed - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Instrument Panel - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Glove Box - Loose, Deformed - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Console, Switches, Vents - Loose, Deformed - Small / Rear Seat - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no spare key, worn tires and Sparetire, No reverse camera, foul smell, Head unit missing, plate and room light issue, headlight issue, warning lamps on, Aircon Blower Weak, Abnormal vibration on engine.</p>