

## General Information

Date & Time: 18, Oct, 2025 09:28

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	13,780
<b>Registration No.</b>	DBO2376	<b>Chassis No.</b>	PA1B18F35P4236656
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



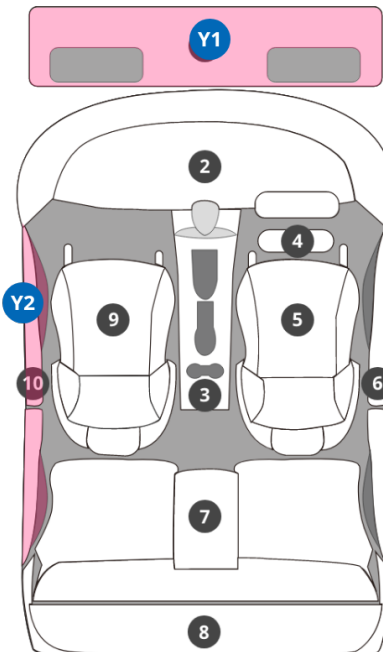
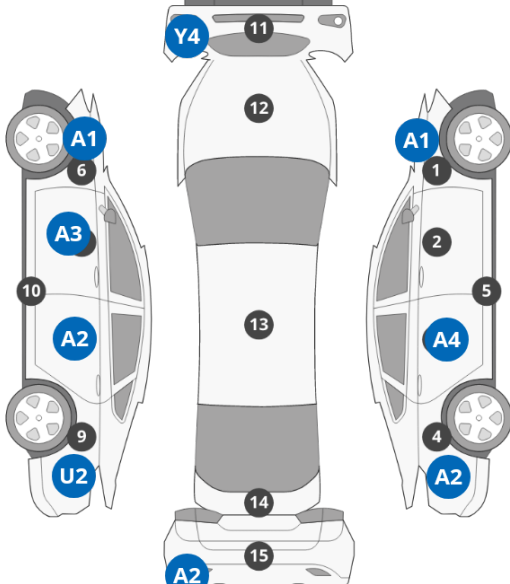
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	121	97	110
2	Boot Lid	105.3	101	106	109
3	Roof	96.5	103	91	93/99
4	Left Front Fender	93.5	98	91	92
5	Left Front Door	94.4	98	93	91
6	Center Panel Left				
7	Left Rear Door	101.9	110	99	97
8	Left Back Panel	107.3	116	102	104
9	Right Front Fender	103.6	105	102	104
10	Right Front Door	98.9	96	103	98
11	Center Panel Right				
12	Right Rear Door	101.8	110	95	100
13	Right Back Panel	106.0	98	104	116

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (L) Rear Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with spare key/No reverse camera/with jack and incomplete tools/with warranty booklet</p>