

## General Information

Date & Time: 13, Oct, 2025 10:40

<b>Make</b>	Nissan	<b>Model</b>	Navara
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	50,282
<b>Registration No.</b>	NED7371	<b>Chassis No.</b>	MNTCC23Z0056647
<b>CC</b>	2.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Brown		

## Body / Panel Condition



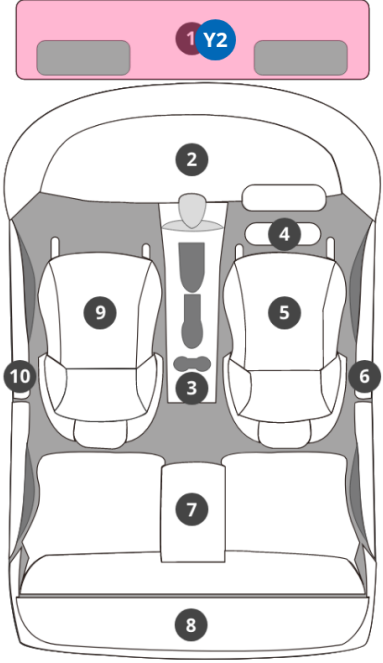
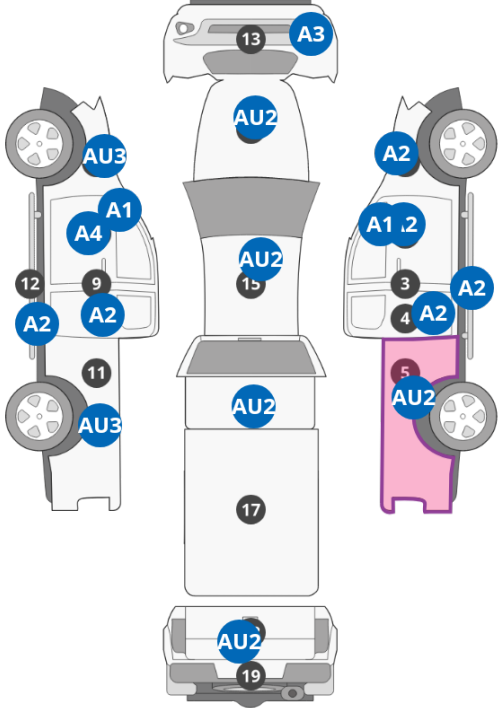
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	105	106	119
2	Boot Lid	97.9	99	98	98
3	Roof	87.9	88	77	97/90
4	Left Front Fender	100.3	102	105	94
5	Left Front Door	84.4	85	85	84
6	Center Panel Left				
7	Left Rear Door	86.1	85	91	83
8	Left Back Panel	100.0	92	106	102
9	Right Front Fender	88.8	86	93	87
10	Right Front Door	91.5	89	95	92
11	Center Panel Right				
12	Right Rear Door	124.6	125	125	124
13	Right Back Panel	161.6	201	134	150

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Ceiling - Grime - Small	<b>Remarks</b> (R) Side Gate - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / Cab Back Panel - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate and Spare tire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no spare key, worn tires, adhesive marks, No reverse camera, plate light issue and headlight bulb issue, horn issue, Room light issue.