

## General Information

Date & Time: 13, Oct, 2025 15:01

<b>Make</b>	Hyundai	<b>Model</b>	Eon
<b>YOM</b>	2016	<b>Odo Meter Reading</b>	59,541
<b>Registration No.</b>	NCI7483	<b>Chassis No.</b>	MALA251AAHM486608
<b>CC</b>	0.8	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Car Sub Compact
<b>Colour</b>	Blue		

## Body / Panel Condition



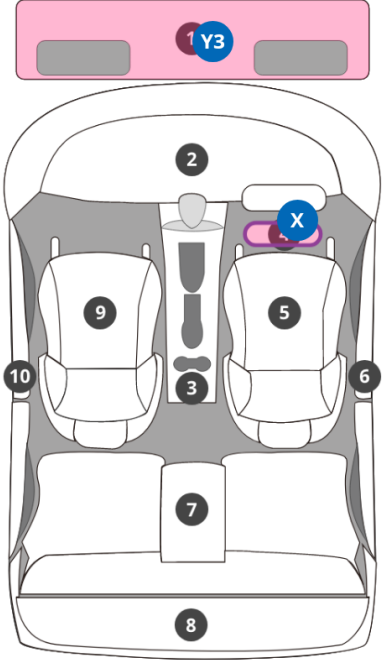
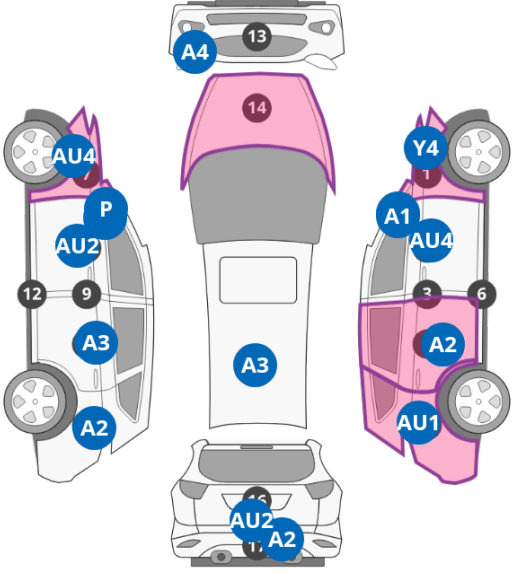
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	175.6	178	179	170
2	Boot Lid	99.2	98	103	97
3	Roof	96.3	100	109	90/87
4	Left Front Fender	197.6	224	203	166
5	Left Front Door	126.0	128	125	125
6	Center Panel Left				
7	Left Rear Door	126.0	132	119	127
8	Left Back Panel	116.6	123	119	108
9	Right Front Fender	128.0	125	135	124
10	Right Front Door	175.3	202	162	162
11	Center Panel Right				
12	Right Rear Door	183.0	165	201	183
13	Right Back Panel	173.0	168	170	181

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Missing - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Large / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Mirror - Scratch - Minimal / (L) Mirror - Faded(Color, Gloss) - Yes / (R) Front Fender, Molding - Crack, Gap - Large / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Small / Roof - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>No LTO plate, with warranty booklet and Sparetire and Jack and Incomplete Tools, No Spare key, worn tires and Sparetire, Scratch headlight and tail light, foul smell, No reverse camera, right door can't open.</p>