

General Information

Date & Time: 13, Oct, 2025 15:02

Make	BMW	Model	520D
YOM	2015	Odo Meter Reading	96,824
Registration No.	ABD6171	Chassis No.	WBA5E0XG059709
CC	2.0	Transmission	A/T
Fuel Type	Diesel	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



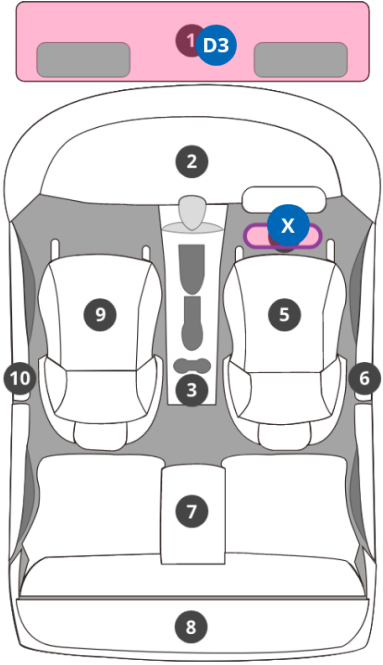
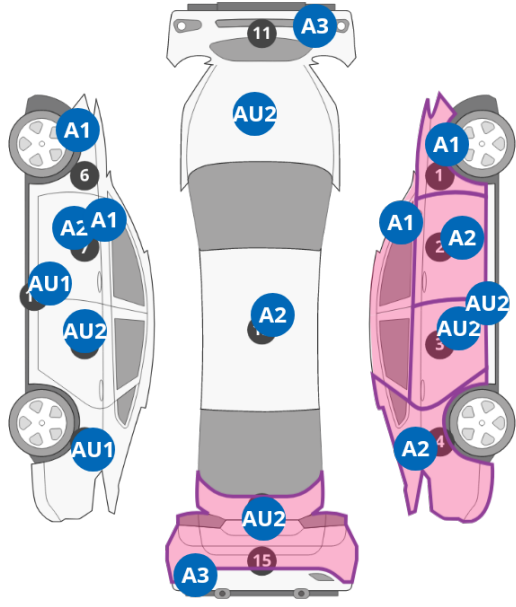
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	122	122	121
2	Boot Lid	106.3	99	103	117
3	Roof	130.2	131	140	127/123
4	Left Front Fender	137.3	148	142	122
5	Left Front Door	125.6	127	128	122
6	Center Panel Left				
7	Left Rear Door	124.3	135	127	111
8	Left Back Panel	125.3	137	126	113
9	Right Front Fender	181.6	167	187	191
10	Right Front Door	415.6	235	238	774
11	Center Panel Right				
12	Right Rear Door	218.3	198	205	252
13	Right Back Panel	153.3	115	161	184

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Ceiling - Loose, Deformed - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, No warranty booklet and Sparetire and Jack and Tools, No Spare key, Scratch headlight and tail light, Worn Tires, foul smell, plate light issue and fog light busted, No reverse camera, weak air-conditioned.