


General Information

Date & Time: 06, Nov, 2025 15:29

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	18,033
Registration No.	NIK3981	Chassis No.	PA1B18F35P4213619
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition

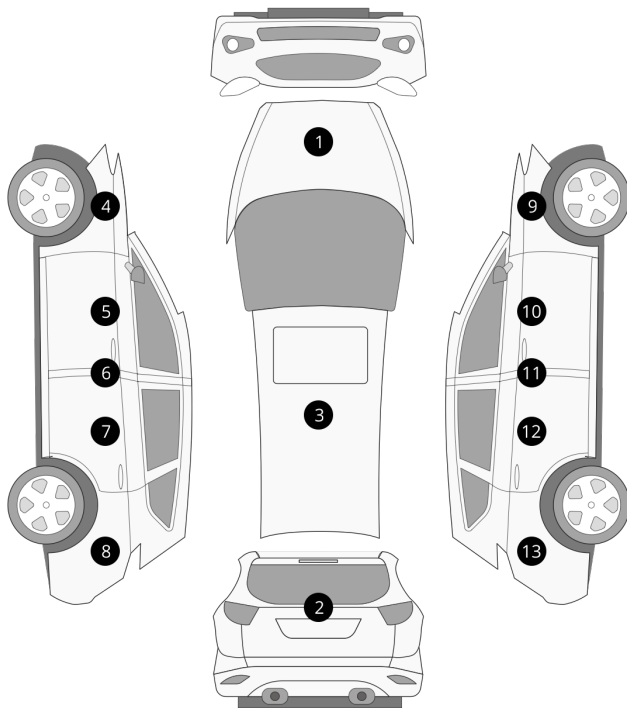

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	102	139	126
2	Boot Lid	161.6	110	118	257
3	Roof	98.5	99	97	108/90
4	Left Front Fender	103.9	107	105	100
5	Left Front Door	104.6	104	109	101
6	Center Panel Left				
7	Left Rear Door	101.1	99	96	109
8	Left Back Panel	148.3	128	156	161
9	Right Front Fender	169.3	153	135	220
10	Right Front Door	174.6	148	204	172
11	Center Panel Right				
12	Right Rear Door	118.6	141	104	111
13	Right Back Panel	115.0	100	118	127

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Rear Trim - Grime - Minimal / Rear Seat - Grime - Small / Rear Seat Head Rest - Worked - Small / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Carpet - Worked - Minimal / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Dashboard - Worked - Minimal / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Minimal / Trunk Room - Worked - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Roof - Scratch - Medium
Frame Evaluation : D	Functional Evaluation : B
Remarks Right Front Pillar - Condition of Welding ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with spare tire and jack, No tools, No VS form/Forced repo/towed unit, No LTO plate