

## General Information

Date & Time: 13, Oct, 2025 18:19

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	20,795
<b>Registration No.</b>	CCG4384	<b>Chassis No.</b>	PA1B18F31R4269723
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blackish Red Mica		

## Body / Panel Condition



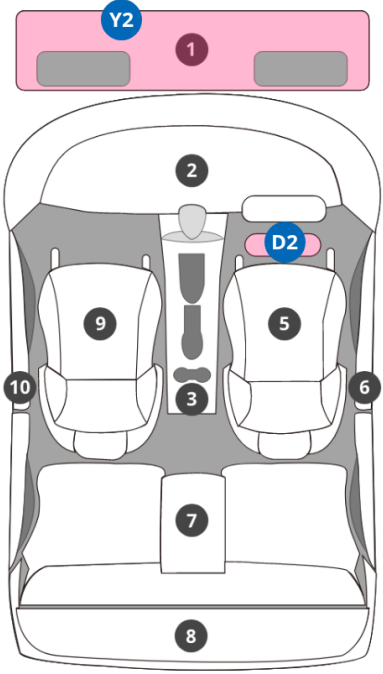
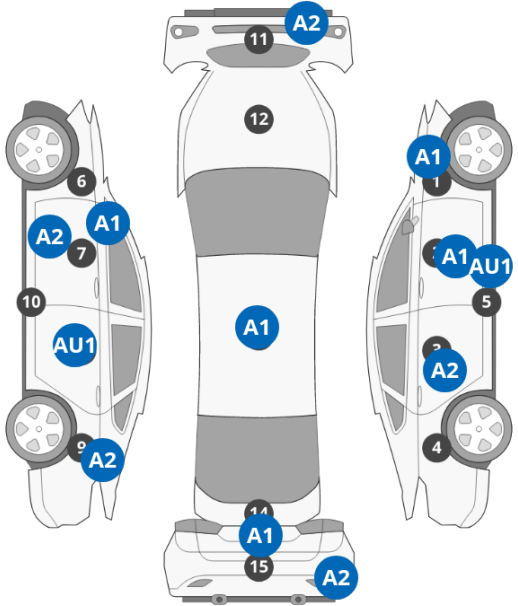
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	111	96	103
2	Boot Lid	100.8	94	101	108
3	Roof	88.0	92	87	81/92
4	Left Front Fender	95.3	95	94	97
5	Left Front Door	95.4	96	96	94
6	Center Panel Left				
7	Left Rear Door	94.8	97	96	92
8	Left Back Panel	106.6	104	108	108
9	Right Front Fender	95.0	95	95	95
10	Right Front Door	91.2	93	92	89
11	Center Panel Right				
12	Right Rear Door	95.0	94	92	99
13	Right Back Panel	97.9	97	96	101

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Head Light, High Beam - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and warranty booklet, No Tools and Jack and Sparetire, Scratch headlight and tail light, headlight issue, Room light issue and plate light busted.</p>