

## General Information

Date & Time: 13, Oct, 2025 18:20

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	54,510
<b>Registration No.</b>	NEP9477	<b>Chassis No.</b>	PA1B18F3256421420
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



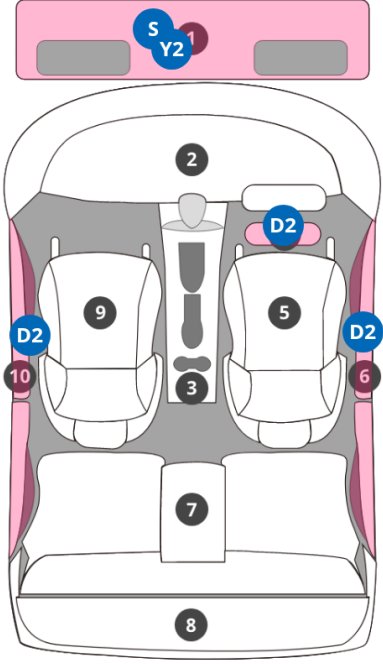
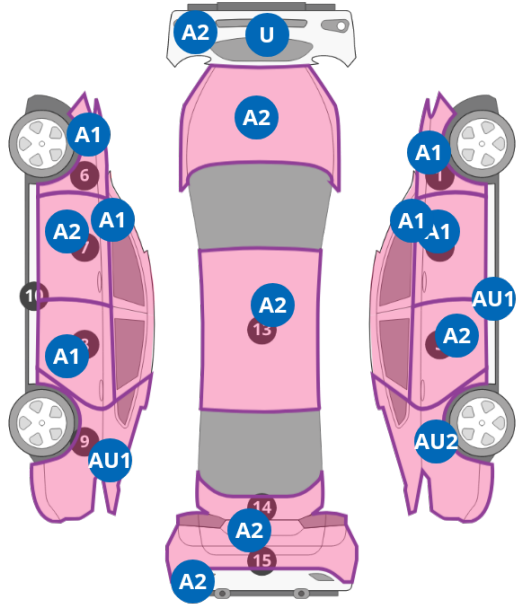
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	256.0	249	249	270
2	Boot Lid	164.3	132	132	229
3	Roof	228.5	595	100	92/127
4	Left Front Fender	544.0	1,031	360	241
5	Left Front Door	372.6	595	267	256
6	Center Panel Left				
7	Left Rear Door	174.0	263	157	102
8	Left Back Panel	226.3	185	241	253
9	Right Front Fender	207.0	110	251	260
10	Right Front Door	115.0	103	100	142
11	Center Panel Right				
12	Right Rear Door	161.3	144	191	149
13	Right Back Panel	181.3	190	193	161

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
<p><b>Remarks</b> Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member &amp; Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Center Pillar - Condition of Welding ? - Yes</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With LTO plate, No Tools and Jack and Warranty booklet and Sparetire, No reverse camera, foul smell, Abnormal shiftshock and vibration on engine, possible flooded.