


## General Information

Date & Time: 28, Oct, 2025 18:03

Make	Mazda	Model	BT50
YOM	2015	Odo Meter Reading	103,767
Registration No.	NDW2335	Chassis No.	MM7UP4DFTFW404667
CC	3.2	Transmission	A/T
Fuel Type	Diesel	Type of Body	Double Cab. Pick-Up
Colour	Gray		

## Body / Panel Condition

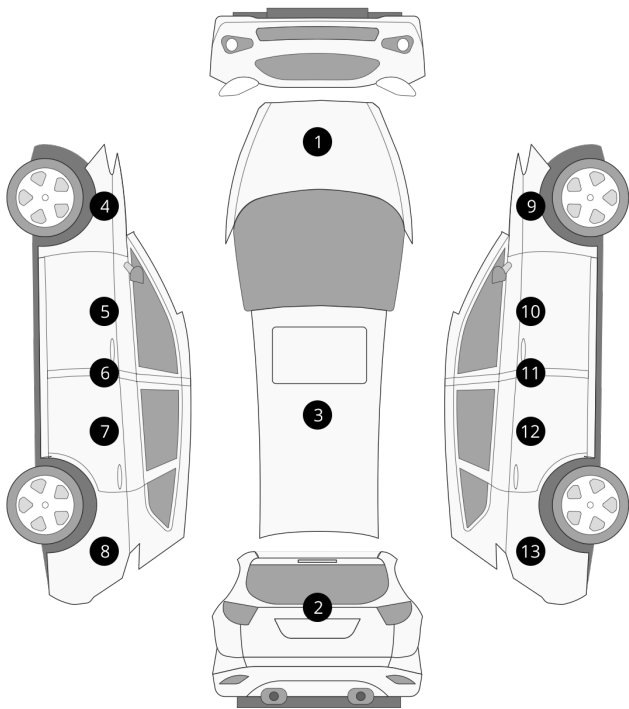

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	151.0	141	173	139
2	Boot Lid	167.0	181	130	190
3	Roof	138.0	135	129	138/150
4	Left Front Fender	138.0	131	142	141
5	Left Front Door	174.6	195	148	181
6	Center Panel Left				
7	Left Rear Door	156.0	174	144	150
8	Left Back Panel	143.3	134	140	156
9	Right Front Fender	178.6	273	138	125
10	Right Front Door	165.0	168	152	175
11	Center Panel Right				
12	Right Rear Door	157.3	160	148	164
13	Right Back Panel	152.3	143	172	142

**Overall Evaluation :**

**D**

**Disclaimer**

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	C	<b>Exterior Evaluation :</b>	E
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (L) Front Seat - Cut, Crack - Large / Steering Wheel - Worn, Peel, Crack - Medium / Overall Interior - Worn as per age - Yes</p>		<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Side Gate - Scratch - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch - Large / Roof - Dent - Small / Bonnet, Headlight - Dent - Small</p>	
<b>Frame Evaluation :</b>	B	<b>Functional Evaluation :</b>	C
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p><b>Remarks</b> Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>	

<b>Inspector Notes</b>
<p>driver window issue/ no jack and tools/ plate light issue / with LTO plate and spare tire/</p>