

General Information

Date & Time: 29, Oct, 2025 10:24

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	21,282
Registration No.	DBN3239	Chassis No.	MHKAA1BC1PJ004244
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Yellow		

Body / Panel Condition



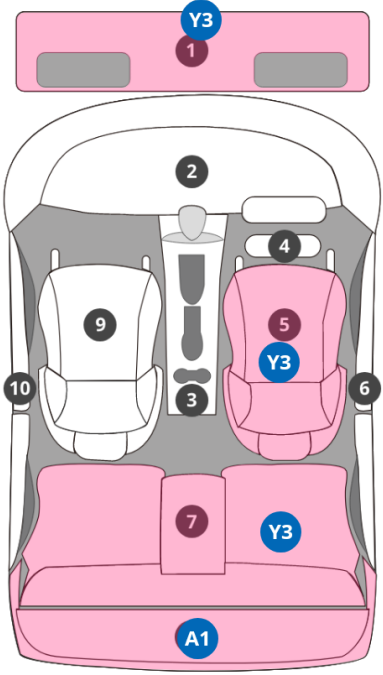
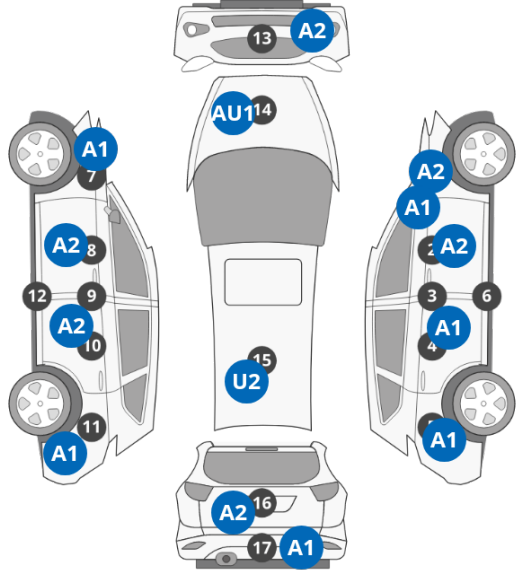
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	219.6	223	232	204
2	Boot Lid	168.3	157	172	176
3	Roof	163.2	152	191	160/150
4	Left Front Fender	308.0	326	281	317
5	Left Front Door	342.3	320	360	347
6	Center Panel Left				
7	Left Rear Door	304.0	308	287	317
8	Left Back Panel	233.6	226	230	245
9	Right Front Fender	202.6	215	211	182
10	Right Front Door	151.0	167	146	140
11	Center Panel Right				
12	Right Rear Door	161.3	170	156	158
13	Right Back Panel	216.6	169	203	278

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with spare key/with reverse camera/with jack and incomplete tools/with warranty booklet</p>