

## General Information

Date & Time: 27, Oct, 2025 08:52

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	33,509
<b>Registration No.</b>	NFC9568	<b>Chassis No.</b>	PA1B18F34P4222358
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



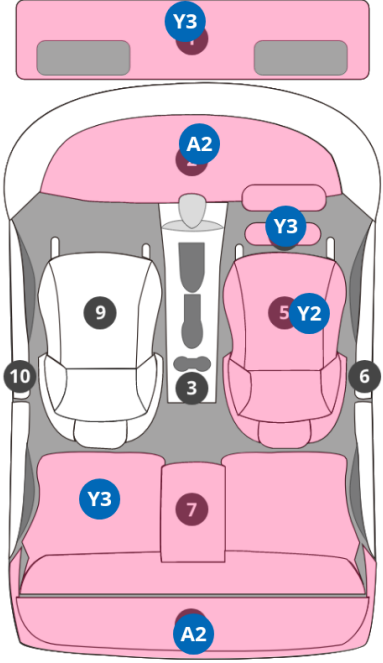
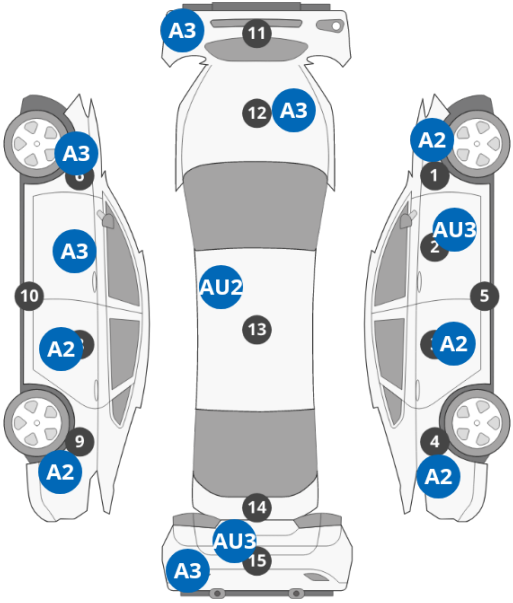
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	126	113	109
2	Boot Lid	115.6	109	116	122
3	Roof	108.2	111	95	116/111
4	Left Front Fender	106.3	108	105	106
5	Left Front Door	103.6	105	104	102
6	Center Panel Left				
7	Left Rear Door	107.0	113	104	104
8	Left Back Panel	125.0	130	136	109
9	Right Front Fender	330.6	782	106	104
10	Right Front Door	102.0	102	101	103
11	Center Panel Right				
12	Right Rear Door	110.0	102	116	112
13	Right Back Panel	114.0	109	111	122

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Small / Rear Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Medium</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with jack and No tools/No warranty booklets/reverse camera not working/No spare key</p>