

General Information

Date & Time: 28, Oct, 2025 12:39

Make	Toyota	Model	Hiace
YOM	2021	Odo Meter Reading	179,070
Registration No.	NGY1198	Chassis No.	JTFNAFAP2L8019034
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



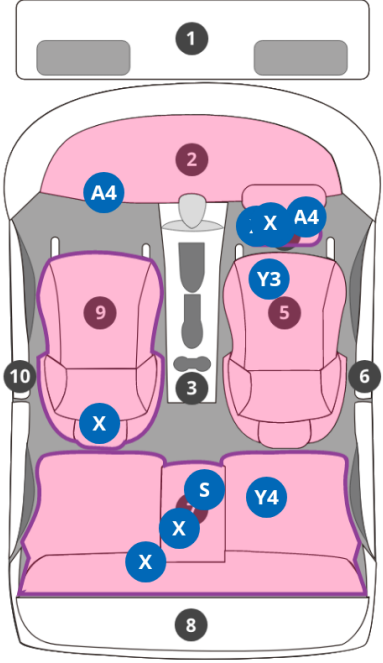
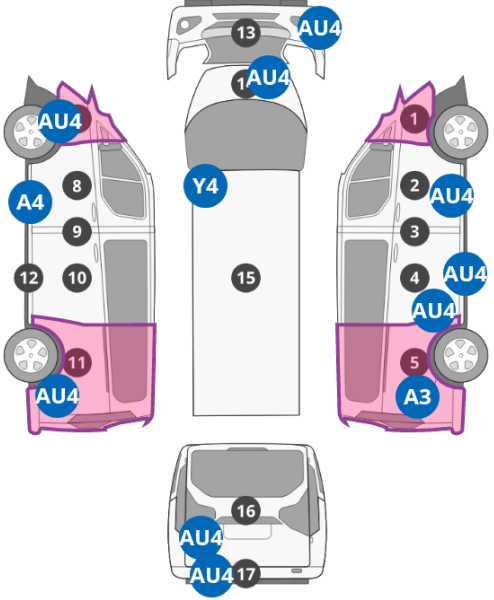
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	78.7	78	81	77
2	Boot Lid	74.5	71	82	71
3	Roof	74.8	76	79	68/77
4	Left Front Fender	77.0	81	79	71
5	Left Front Door	74.8	77	76	72
6	Center Panel Left	75.6	75	76	76
7	Left Rear Door				
8	Left Back Panel	66.5	63	66	71
9	Right Front Fender	79.5	75	82	82
10	Right Front Door	76.7	70	78	82
11	Center Panel Right	86.7	85	95	80
12	Right Rear Door	78.5	76	85	75
13	Right Back Panel	76.9	77	73	81

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Carpet - Worn, Scratch, Cut, Crack - Large / Overall Interior - Smell - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Large / (R) Front Seat - Grime - Medium / Rear Seat - Partially Missing - Yes / Steering Wheel - Worn, Peel, Crack - Large / (L) Front Seat Head Rest - Missing - Yes / Rear Seat Head Rest - Missing - Yes</p>	<p>Remarks Bonnet - Repair Traces - Yes / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Windshield - Damaged - Large / (R) Rear Fender, Molding - Scratch - Medium / (L) Front Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no tools and jack/ possible flooding/ driver window issue/ no spare tire/ with LTO plate/</p>