

## General Information

Date & Time: 27, Oct, 2025 13:32

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	110,652
<b>Registration No.</b>	DAP3696	<b>Chassis No.</b>	PA1B18F34M4157149
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



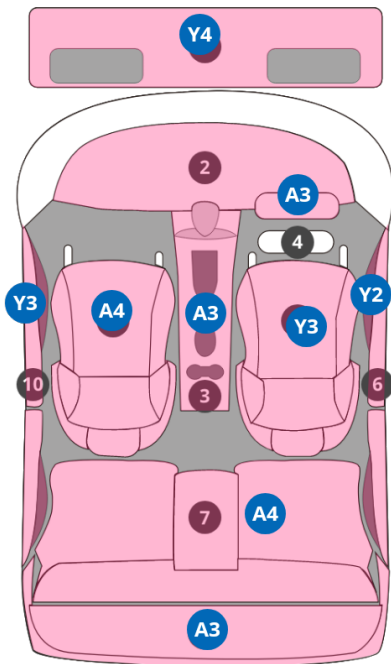
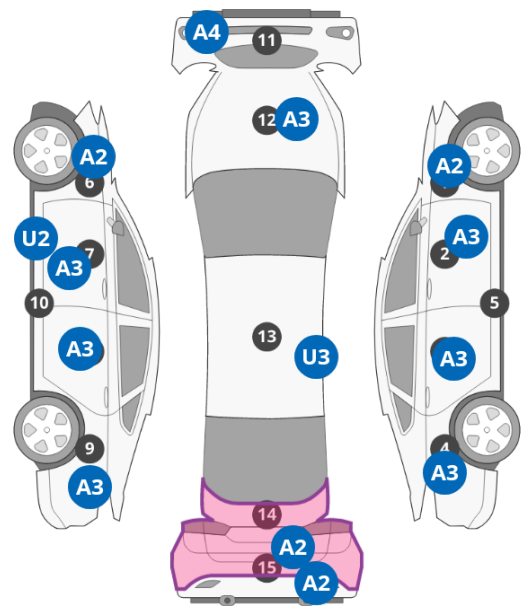
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.8	109	98	99
2	Boot Lid	276.3	240	285	304
3	Roof	96.5	96	92	88/110
4	Left Front Fender	96.2	95	94	100
5	Left Front Door	104.6	100	108	106
6	Center Panel Left				
7	Left Rear Door	100.5	101	100	101
8	Left Back Panel	109.3	122	106	100
9	Right Front Fender	91.1	97	95	82
10	Right Front Door	97.0	101	94	96
11	Center Panel Right				
12	Right Rear Door	92.9	90	91	98
13	Right Back Panel	99.8	102	98	100

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>E</b>	<b>Exterior Evaluation :</b>	<b>E</b>
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Cut, Crack - Large / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Cut, Crack - Large / Ceiling - Grime - Large / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium</p>		<p><b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / Roof - Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Dent - Small / Trunk Hood, Rear Gate - Repair mark - Yes</p>	
<b>Frame Evaluation :</b>	<b>A</b>	<b>Functional Evaluation :</b>	<b>B</b>
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>	

## Inspector Notes

with LTO plate/with spare tire/No warranty booklets/No reverse camera/with jack and incomplete tools/No spare key/left side tail light cover medium crack/Plate light issue/Horn issue