

General Information

Date & Time: 28, Oct, 2025 09:33

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Avanza |
| YOM | 2020 | Odo Meter Reading | 150,811 |
| Registration No. | DBA4494 | Chassis No. | MHKM5EF2FLK024300 |
| CC | 1.3 | Transmission | A/T |
| Fuel Type | Gas | Type of Body | Wagon |
| Colour | Gray | | |

Body / Panel Condition



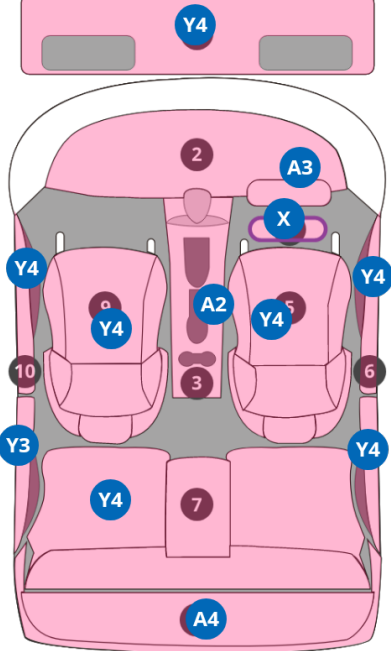
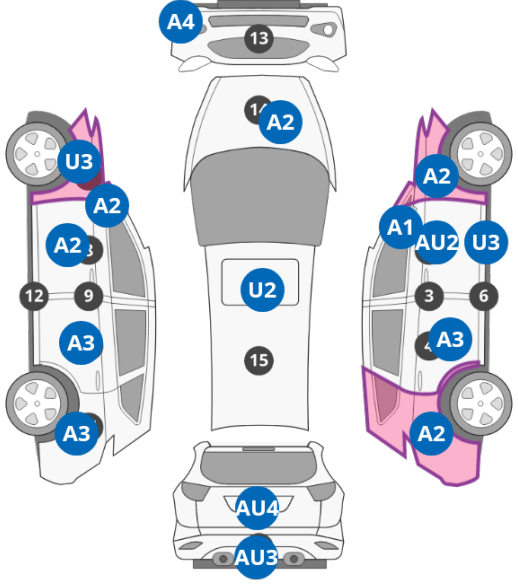
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 122.3 | 128 | 131 | 108 |
| 2 | Boot Lid | 110.0 | 104 | 118 | 108 |
| 3 | Roof | 110.7 | 100 | 108 | 110/125 |
| 4 | Left Front Fender | 177.6 | 168 | 192 | 173 |
| 5 | Left Front Door | 115.6 | 128 | 111 | 108 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 116.0 | 118 | 115 | 115 |
| 8 | Left Back Panel | 98.4 | 88 | 101 | 106 |
| 9 | Right Front Fender | 211.3 | 240 | 198 | 196 |
| 10 | Right Front Door | 161.6 | 176 | 136 | 173 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 153.6 | 154 | 128 | 179 |
| 13 | Right Back Panel | 195.3 | 137 | 186 | 263 |

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | | | |
|--|----------|---|----------|
| Interior Evaluation : | E | Exterior Evaluation : | E |
|  | |  | |
| <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> | | <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> | |
| <p>Remarks Rear Seat - Grime - Large / (R) Rear Trim - Grime - Large / (R) Front Trim - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Large / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / Steering Wheel - Worn, Peel, Crack - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Large</p> | | <p>Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Dent - Medium / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Roof - Dent - Small / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes</p> | |
| <p>Frame Evaluation :</p> | | <p>Functional Evaluation :</p> | |
| A | | B | |
| <p>Remarks Defects not found</p> | | <p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p> | |

| |
|--|
| Inspector Notes |
| with LTO plate/No spare tire/No warranty booklet/No reverse camera/No spare key/No jack and No tools NO fog lights/possible flooding |