

## General Information

Date & Time: 27, Oct, 2025 12:44

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	15,377
<b>Registration No.</b>	DBB6262	<b>Chassis No.</b>	PA1B18F32P4208605
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



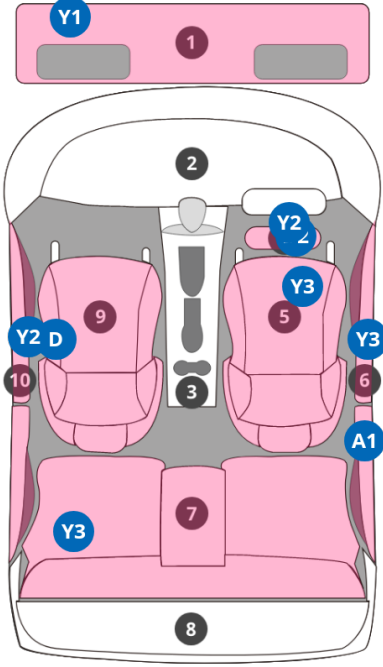
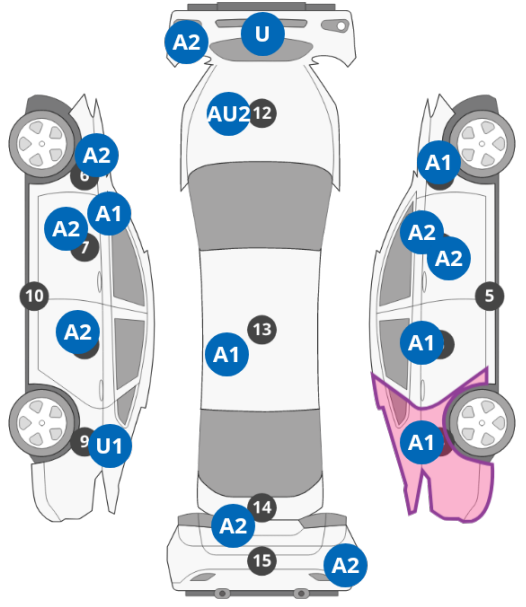
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	115	107	114
2	Boot Lid	86.9	85	85	91
3	Roof	97.6	103	102	86/100
4	Left Front Fender	178.6	152	162	222
5	Left Front Door	158.3	155	155	165
6	Center Panel Left				
7	Left Rear Door	173.0	192	152	175
8	Left Back Panel	169.3	164	171	173
9	Right Front Fender	109.3	110	105	113
10	Right Front Door	101.6	104	100	101
11	Center Panel Right				
12	Right Rear Door	107.0	108	104	109
13	Right Back Panel	152.0	145	148	163

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, improvised licensed plate, possible flooding, scratches on tail light</p>