

## General Information

Date & Time: 27, Oct, 2025 14:29

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	16,216
<b>Registration No.</b>	DBT4629	<b>Chassis No.</b>	PA1B18F37R4260427
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



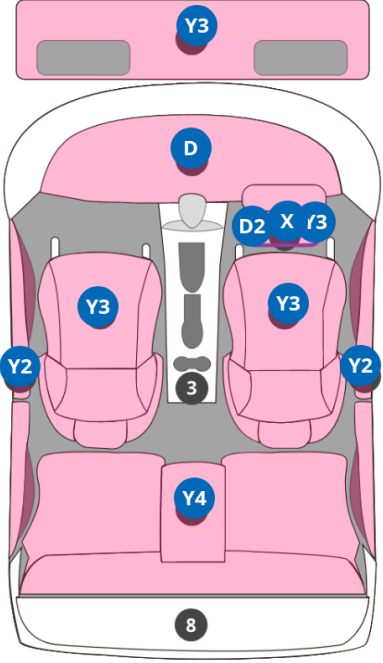
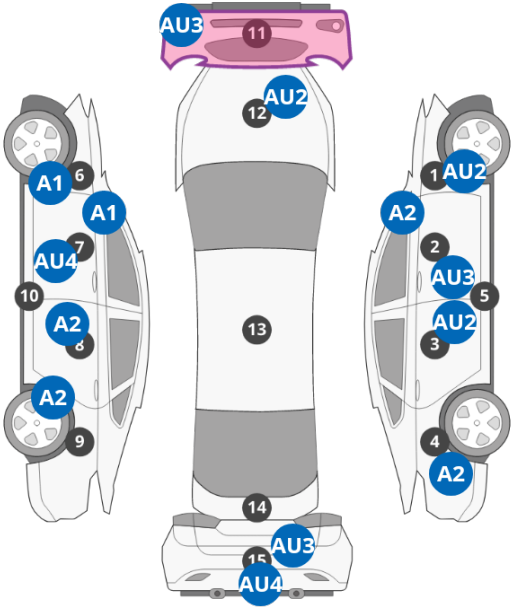
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.6	103	100	102
2	Boot Lid	109.3	102	113	113
3	Roof	96.8	98	100	95/96
4	Left Front Fender	93.8	96	92	94
5	Left Front Door	99.6	104	99	96
6	Center Panel Left				
7	Left Rear Door	101.7	105	102	98
8	Left Back Panel	109.0	124	105	98
9	Right Front Fender	100.6	100	102	100
10	Right Front Door	99.8	99	100	101
11	Center Panel Right				
12	Right Rear Door	100.5	101	98	103
13	Right Back Panel	108.2	99	106	120

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small</p>	<p><b>Remarks</b> Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>Front bumper repaired. Without warranty booklet, spare tire, jack and tools. With seat cover. 3 keys. No LTO plate.</p>