

General Information

Date & Time: 30, Oct, 2025 14:55

Make	Toyota	Model	Hiace
YOM	2019	Odo Meter Reading	92,126
Registration No.	NDN5773	Chassis No.	JTFNAFAP8K8008814
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition




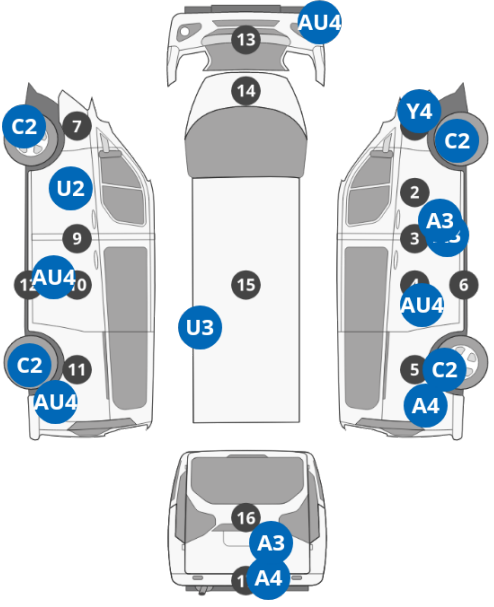
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	149.6	144	143	162
2	Boot Lid	117.0	116	116	119
3	Roof	149.2	194	142	127/134
4	Left Front Fender	216.0	205	225	218
5	Left Front Door	141.6	151	141	133
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	139.6	126	147	146
9	Right Front Fender	144.0	157	143	132
10	Right Front Door	139.0	127	138	152
11	Center Panel Right	141.6	140	150	135
12	Right Rear Door	135.3	132	135	139
13	Right Back Panel	140.6	143	138	141

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
<div style="text-align: center; background-color: #cccccc; padding: 50px;">  <p>No Image</p> </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (R) Front Seat - Grime - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Center Panel - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Wheel, Cover - Scratch, Corrosion - Small / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Front Wheel, Cover - Scratch, Corrosion - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / Roof - Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet /no jack and tools/ abnormal engine noise/ abnormal shifter vibrations/ stuck power windows/ with LTO plate and sparetire/</p>