

## General Information

Date & Time: 24, Oct, 2025 15:27

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	22,056
<b>Registration No.</b>	NFB7196	<b>Chassis No.</b>	PA1B18F38P4218331
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



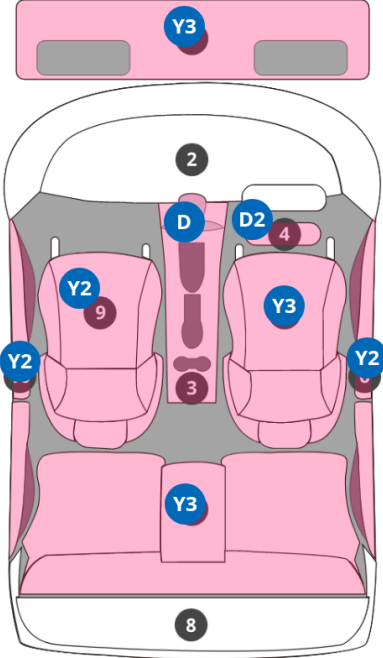
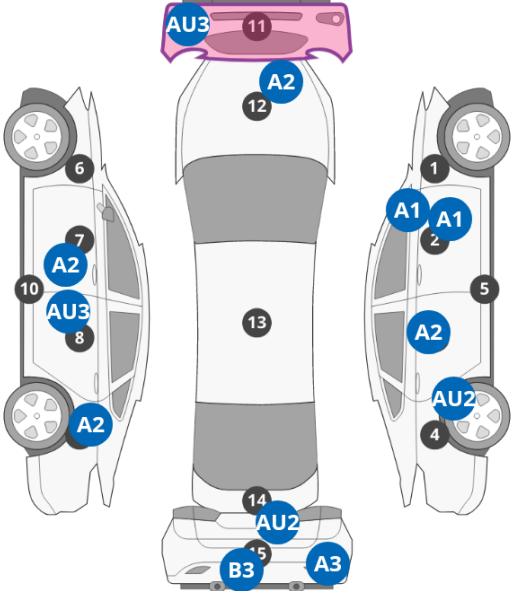
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	117	113	120
2	Boot Lid	123.3	110	130	130
3	Roof	116.7	118	121	101/127
4	Left Front Fender	103.6	109	100	102
5	Left Front Door	107.0	102	104	115
6	Center Panel Left				
7	Left Rear Door	123.6	134	119	118
8	Left Back Panel	126.0	142	121	115
9	Right Front Fender	114.0	111	111	120
10	Right Front Door	115.0	116	111	118
11	Center Panel Right				
12	Right Rear Door	123.0	115	118	136
13	Right Back Panel	127.0	127	116	138

**Overall Evaluation :**

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Modified - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet, seat cover and tools. With spare tire and jack. 1 key. With LTO plate.</p>