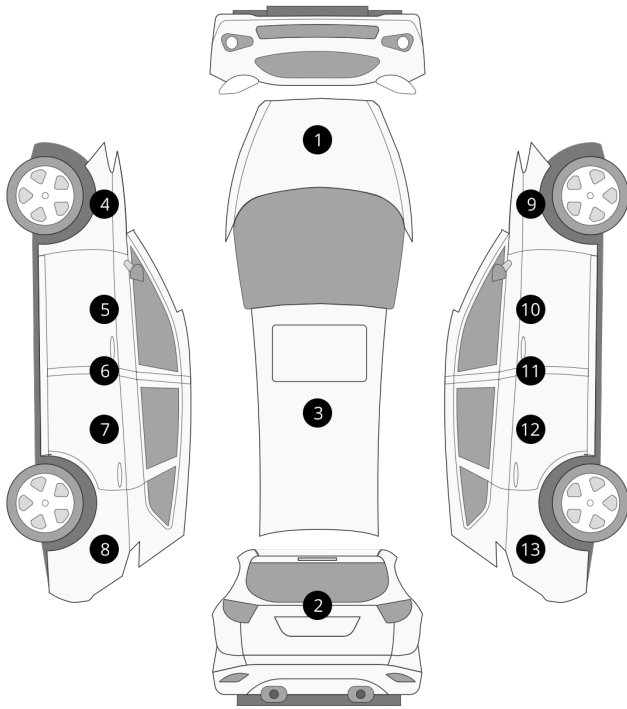


General Information

Date & Time: 27, Oct, 2025 17:10

Make	Toyota	Model	86
YOM	2016	Odo Meter Reading	29,921
Registration No.	ABQ9563	Chassis No.	JF1ZN6L81GG023803
CC	2.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Coupe
Colour	White		

Body / Panel Condition



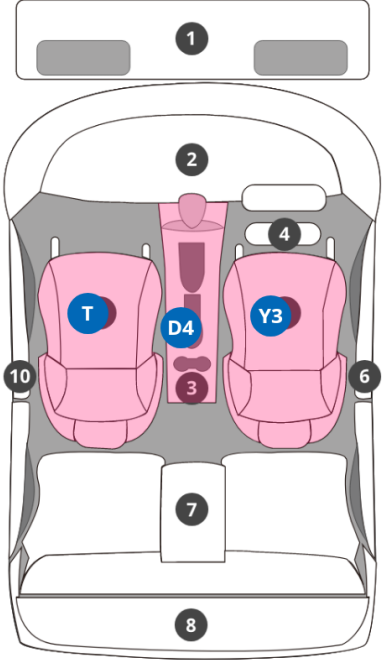
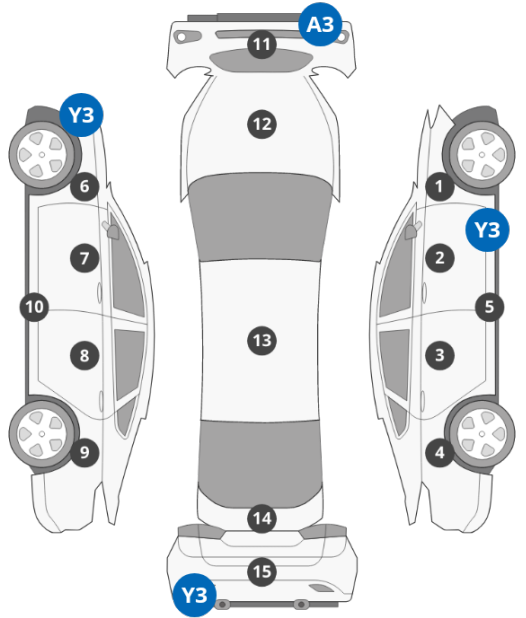
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	284.6	284	284	286
2	Boot Lid	137.6	155	135	123
3	Roof	125.0	129	129	118/124
4	Left Front Fender	319.3	323	311	324
5	Left Front Door	138.3	144	134	137
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	130.0	138	130	122
9	Right Front Fender	309.6	300	319	310
10	Right Front Door	128.3	123	121	141
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	130.6	114	121	157

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Console, Switches, Vents - Loose, Deformed - Large / (L) Front Seat - Cigarette Burns - Burnt, Hole</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Air Conditioner - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ no tools/ sun visor light issue/ loose rear view mirror/ with jack and spare tire/ with LTO plate</p>