

## General Information

Date & Time: 25, Oct, 2025 15:56

<b>Make</b>	Suzuki	<b>Model</b>	Dzire
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	23,337
<b>Registration No.</b>	LAM1993	<b>Chassis No.</b>	MBHZF63S7R441984
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Brown		

## Body / Panel Condition



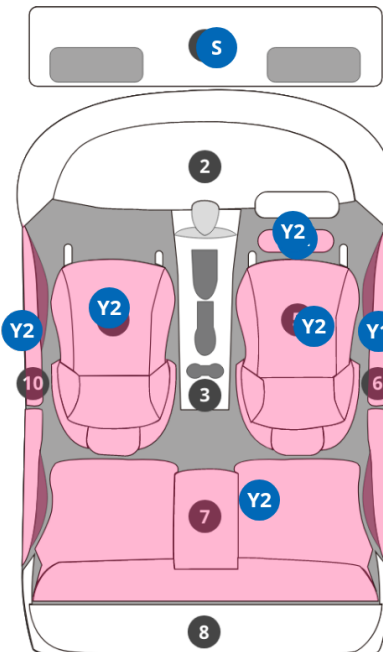
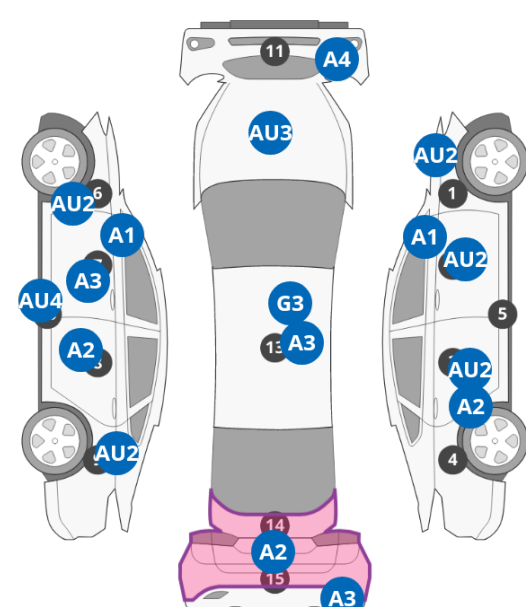
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.3	100	100	104
2	Boot Lid	163.0	124	150	215
3	Roof	99.3	99	100	101/98
4	Left Front Fender	101.3	108	102	94
5	Left Front Door	100.3	100	96	105
6	Center Panel Left				
7	Left Rear Door	93.2	97	92	90
8	Left Back Panel	96.2	94	99	96
9	Right Front Fender	97.3	94	98	100
10	Right Front Door	94.4	89	94	100
11	Center Panel Right				
12	Right Rear Door	93.8	96	88	97
13	Right Back Panel	102.2	98	100	109

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch &amp; Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Front Windshield - Scratch, Stone chip - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, no reverse camera, foul smell, possible flooded, worn tires, Scratch headlight and tail light.</p>