

General Information

Date & Time: 27, Oct, 2025 17:55

Make	Suzuki	Model	Carry
YOM	2021	Odo Meter Reading	74,792
Registration No.	NEM2336	Chassis No.	NHYHDC61TMJ908094
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



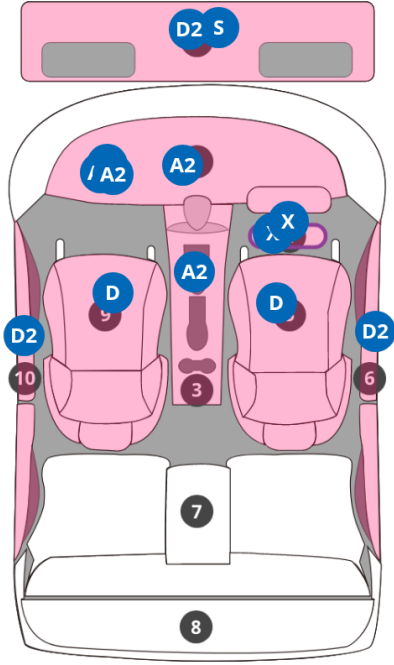
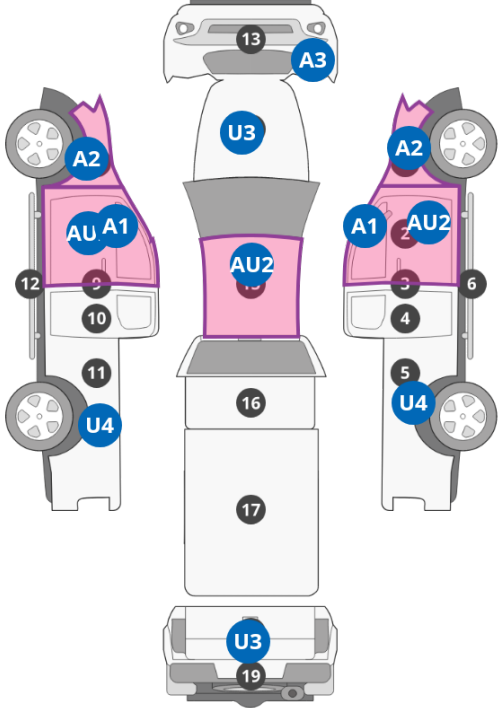
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	160.6	159	136	187
2	Boot Lid	20.0	17	25	17
3	Roof	132.2	165	106	134/124
4	Left Front Fender	148.6	148	147	151
5	Left Front Door	116.6	115	118	117
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	19.0	17	17	23
9	Right Front Fender	160.6	169	150	163
10	Right Front Door	137.0	139	135	137
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	17.7	21	17	15

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Glove Box - Loose, Deformed - Small / Instrument Panel - Worn, Scratch, Cut, Crack - Minimal / Steering Wheel - Worn, Peel, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Trim - Loose, Deformed - Small / (R) Front Trim - Loose, Deformed - Small / Ceiling - Loose, Deformed - Small</p>	<p>Remarks Front Panel - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Front Panel - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Side Gate - Dent - Large / Rear Gate - Dent - Medium / (R) Side Gate - Dent - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no spare key, worn tires and Sparetire, No reverse camera, foul smell, headlight issue and plate light busted, foglight issue, Room light issue, tail light busted, air-conditioned issue.</p>