

General Information

Date & Time: 27, Oct, 2025 18:33

Make	Subaru	Model	XV
YOM	2016	Odo Meter Reading	81,648
Registration No.	NCF3617	Chassis No.	JF1GP7LC5GG258034
CC	2.0	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



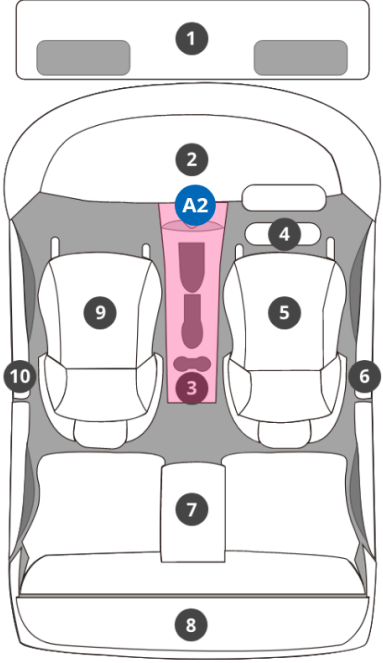
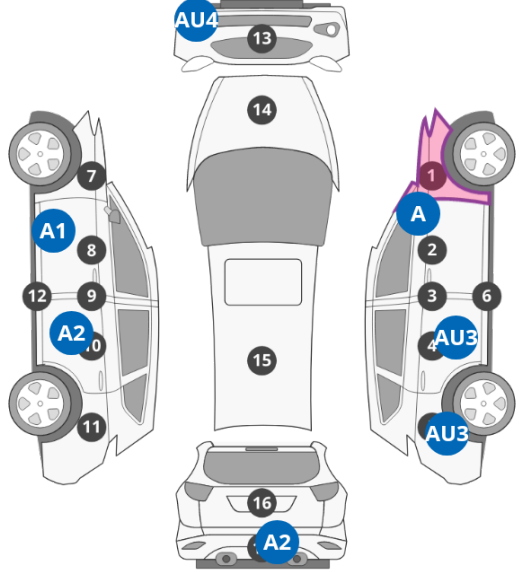
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	107	145	122
2	Boot Lid	98.2	103	92	100
3	Roof	107.5	113	111	101/105
4	Left Front Fender	136.3	134	119	156
5	Left Front Door	170.6	156	162	194
6	Center Panel Left				
7	Left Rear Door	299.6	379	284	236
8	Left Back Panel	213.0	208	185	246
9	Right Front Fender	115.0	107	125	113
10	Right Front Door	213.6	222	182	237
11	Center Panel Right				
12	Right Rear Door	257.6	279	232	262
13	Right Back Panel	140.3	178	133	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	A	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Knobs - Worn, Peel, Crack - Small</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch, Peeled - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Overall Exterior - Full Re-Paint in same color - Yes</p>	
Frame Evaluation :	A	Functional Evaluation :	C
<p>Remarks Defects not found</p>		<p>Remarks Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
<p>With Lto plate, 1 key, with spare tire and jack, no tools, front rim Right scratches, scratch headlight and tail light, aircon issue</p>