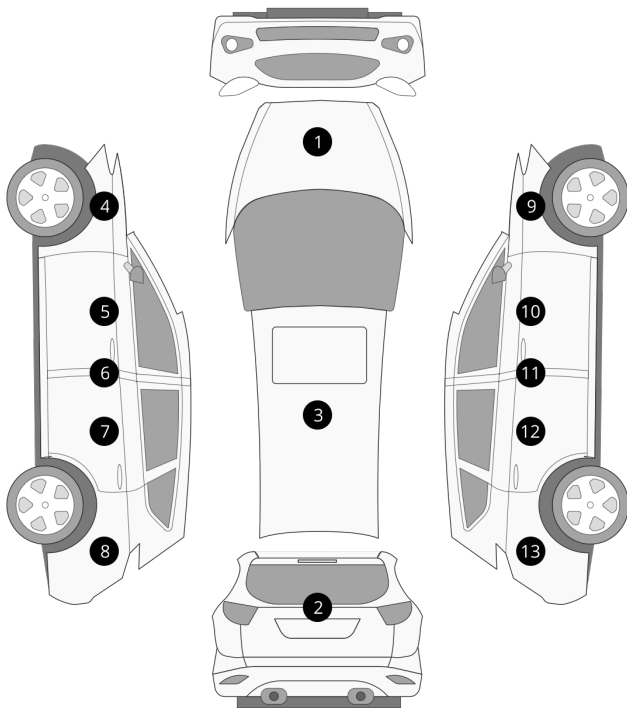


## General Information

Date & Time: 27, Oct, 2025 17:58

<b>Make</b>	Toyota	<b>Model</b>	Veloz
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	6,866
<b>Registration No.</b>	NKL7628	<b>Chassis No.</b>	MHFAB1BY9R3128258
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Wagon
<b>Colour</b>	White		

## Body / Panel Condition



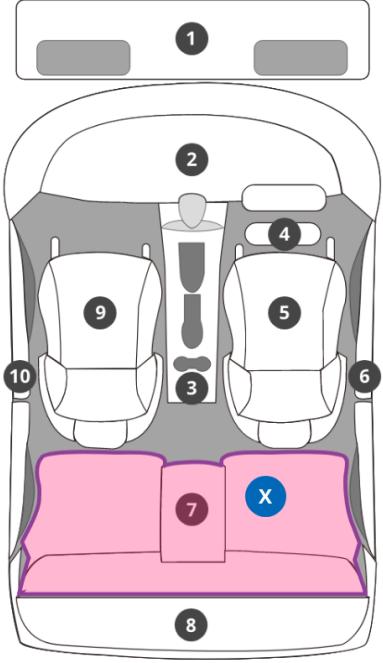
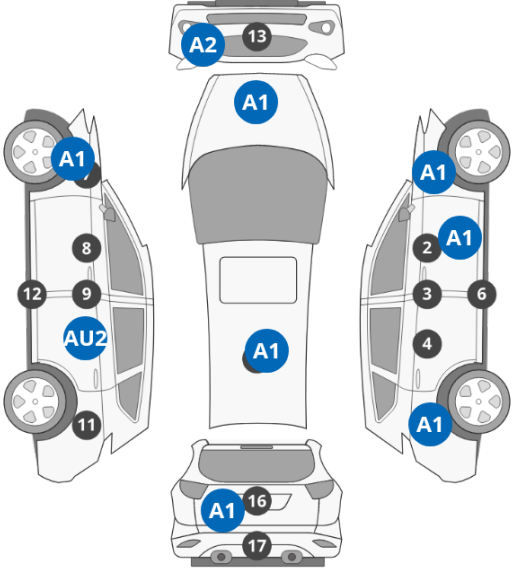
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.2	105	93	115
2	Boot Lid	114.3	112	117	114
3	Roof	132.5	138	126	126/140
4	Left Front Fender	114.6	120	111	113
5	Left Front Door	123.3	116	124	130
6	Center Panel Left				
7	Left Rear Door	117.0	120	112	119
8	Left Back Panel	135.0	137	136	132
9	Right Front Fender	118.0	120	119	115
10	Right Front Door	124.6	130	121	123
11	Center Panel Right				
12	Right Rear Door	117.0	116	112	123
13	Right Back Panel	142.0	126	138	162

**Overall Evaluation :**

B

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>B</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Rear Seat - Missing - Yes	<b>Remarks</b> (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>C</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Warning Lamps - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
With LTO plate, No warranty booklet and Sparetire and Jack and Tools, scratch headlight and tail light, no spare key, warning lamps on, partially missing parts wiper cover, horn issue.