


General Information

Date & Time: 29, Oct, 2025 08:03

Make	Toyota	Model	Innova
YOM	2012	Odo Meter Reading	411,060
Registration No.	UOU587	Chassis No.	TGN405056154
CC	2.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition

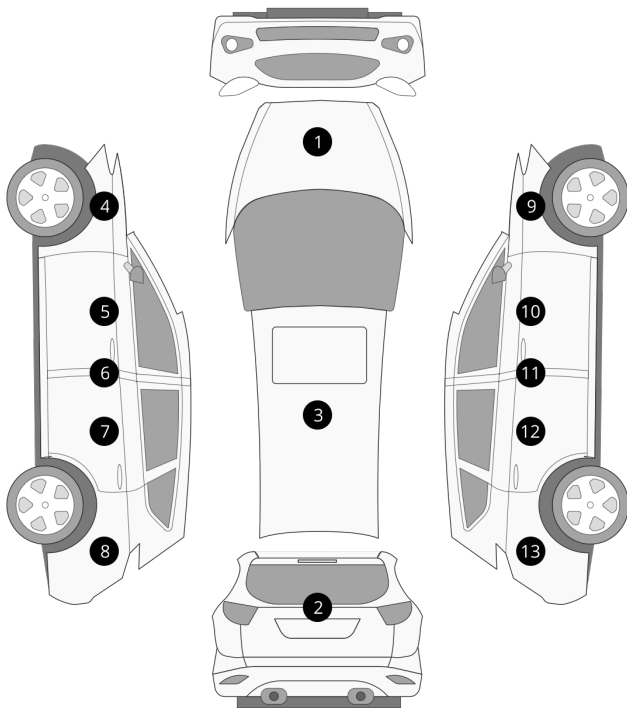

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	140.6	129	138	155
2	Boot Lid	256.3	253	232	284
3	Roof	157.5	172	162	152/144
4	Left Front Fender	187.6	150	182	231
5	Left Front Door	335.6	247	176	584
6	Center Panel Left				
7	Left Rear Door	202.0	197	202	207
8	Left Back Panel	346.6	605	217	218
9	Right Front Fender	179.3	194	184	160
10	Right Front Door	209.6	189	208	232
11	Center Panel Right				
12	Right Rear Door	329.3	261	301	426
13	Right Back Panel	577.0	256	246	1,229

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Steering Wheel - Worn, Peel, Crack - Large / Overall Interior - Worn as per age - Yes / (L) Front Seat - Cut, Crack - Large</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (L) Front Fender, Molding - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small</p>	
Frame Evaluation :	B	Functional Evaluation :	D
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>	

Inspector Notes
fuel issue/engine issue/ check engine light/ incomplete tools/ with LTO plate and warranty booklet/