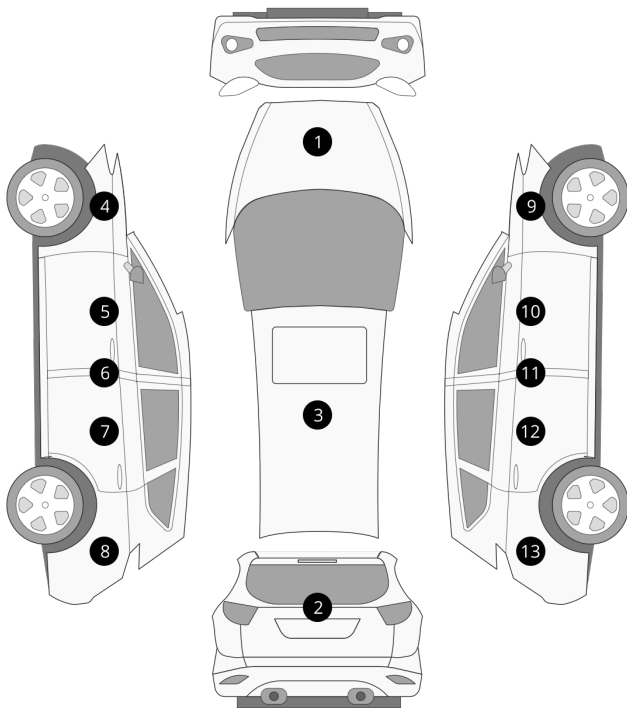


General Information

Date & Time: 28, Oct, 2025 15:41

Make	Isuzu	Model	Crosswind
YOM	2017	Odo Meter Reading	132,528
Registration No.	NAI8570	Chassis No.	PABTBR54FH2094931
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	White		

Body / Panel Condition



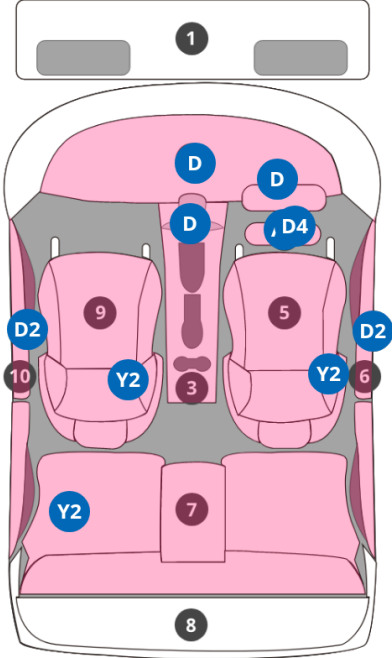
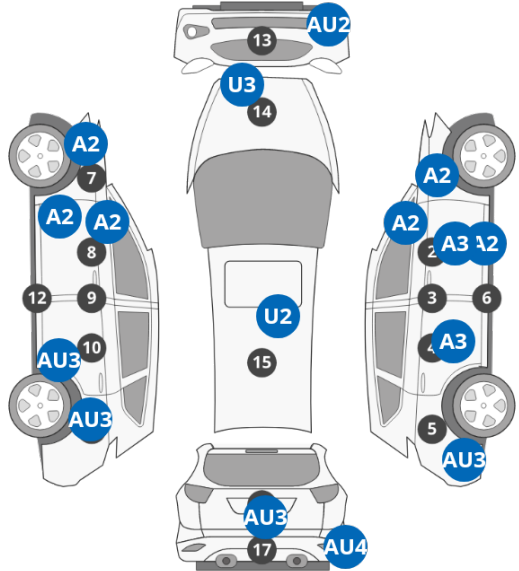
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	148.0	144	129	171
2	Boot Lid	115.0	113	109	123
3	Roof	115.5	123	125	112/102
4	Left Front Fender	114.0	112	102	128
5	Left Front Door	102.8	98	111	100
6	Center Panel Left				
7	Left Rear Door	102.5	110	94	104
8	Left Back Panel	105.9	133	100	85
9	Right Front Fender	108.0	107	101	116
10	Right Front Door	91.8	88	95	93
11	Center Panel Right				
12	Right Rear Door	108.0	106	107	111
13	Right Back Panel	126.6	116	123	141

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Small / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Glove Box - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Large</p>	<p>Remarks (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / Roof - Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack headlights, air-conditioning system issue, suspension issue</p>