

## General Information

Date & Time: 30, Oct, 2025 15:18

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	25,980
<b>Registration No.</b>	NFR7465	<b>Chassis No.</b>	PA1B18F31R4251934
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



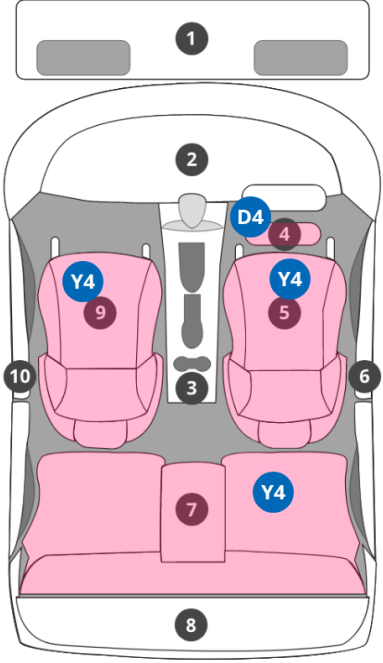
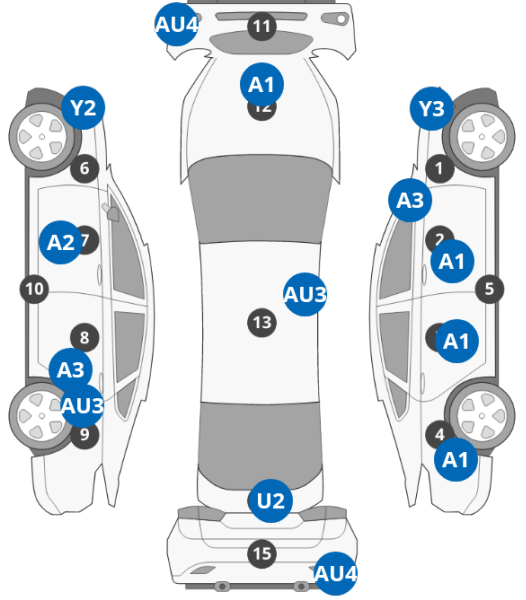
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	113	109	105
2	Boot Lid	102.9	104	98	107
3	Roof	100.2	105	100	95/101
4	Left Front Fender	130.3	138	131	122
5	Left Front Door	101.4	105	99	100
6	Center Panel Left				
7	Left Rear Door	194.0	256	148	178
8	Left Back Panel	134.3	104	164	135
9	Right Front Fender	226.0	330	183	165
10	Right Front Door	245.3	155	401	180
11	Center Panel Right				
12	Right Rear Door	247.3	237	223	282
13	Right Back Panel	112.3	109	104	124

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Dent - Small / (R) Mirror - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Front Fender, Molding - Crack, Gap - Small / (R) Front Fender, Molding - Crack, Gap - Medium / Roof - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet and LTO plate/ no tools/ with jack and spare tire/</p>