


## General Information

Date & Time: 29, Oct, 2025 15:35

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	17,422
<b>Registration No.</b>	DBF8182	<b>Chassis No.</b>	PA1B18F30R4253352
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition

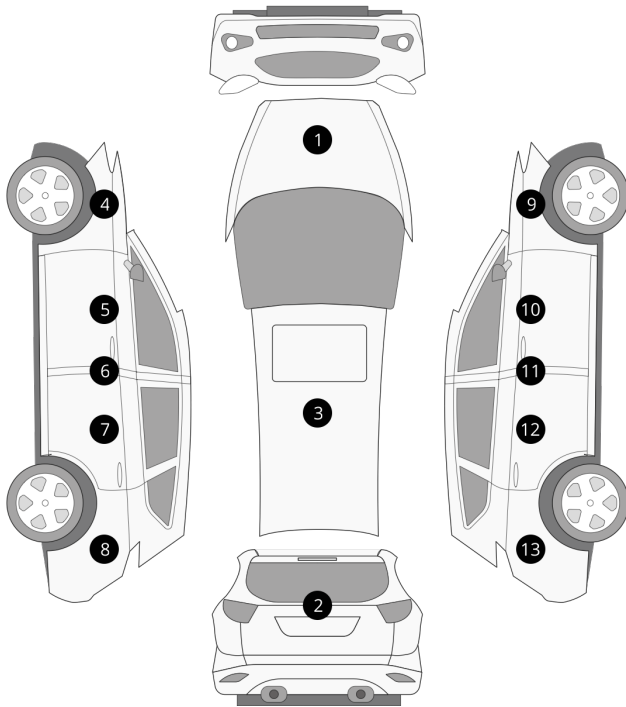

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	122	102	115
2	Boot Lid	105.3	102	106	108
3	Roof	102.2	101	107	96/105
4	Left Front Fender	95.8	94	99	95
5	Left Front Door	102.0	102	102	102
6	Center Panel Left				
7	Left Rear Door	105.0	106	104	105
8	Left Back Panel	111.6	126	101	108
9	Right Front Fender	102.9	110	99	100
10	Right Front Door	103.5	98	101	112
11	Center Panel Right				
12	Right Rear Door	105.6	98	106	113
13	Right Back Panel	103.3	100	106	104

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 1.5em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 1.5em;">D</span>
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Trim - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-size: 1.5em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 1.5em;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<b>Inspector Notes</b>
<p>with LTO plate/with spare tire/with reverse camera/with warranty booklet/with jack and incomplete tools/No spare key</p>