

## General Information

Date & Time: 30, Oct, 2025 15:43

<b>Make</b>	Suzuki	<b>Model</b>	Dzire
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	5,625
<b>Registration No.</b>	NKO9128	<b>Chassis No.</b>	MBHZF63S0SG592140
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



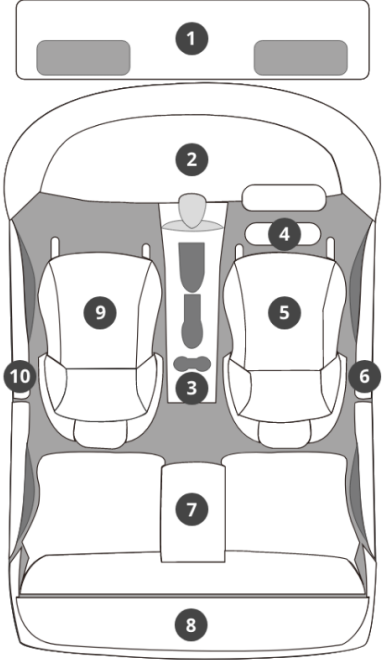
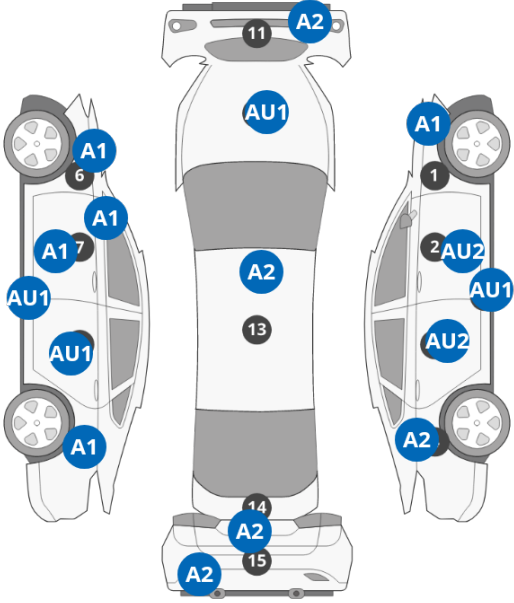
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	104	109	115
2	Boot Lid	88.5	86	94	85
3	Roof	112.5	102	105	130/113
4	Left Front Fender	104.6	102	109	103
5	Left Front Door	103.0	101	104	104
6	Center Panel Left				
7	Left Rear Door	98.0	105	99	91
8	Left Back Panel	99.2	100	100	98
9	Right Front Fender	106.3	106	107	106
10	Right Front Door	101.5	97	99	109
11	Center Panel Right				
12	Right Rear Door	96.8	96	94	101
13	Right Back Panel	108.3	107	104	114

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Defects not found	<b>Remarks</b> (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Reverse Camera - N/A - Yes

<b>Inspector Notes</b>
with LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, scratch headlight and tail light, no reverse camera, foul smell, worn tires, adhesive marks on vehicle, Abnormal vibration on engine.