

General Information

Date & Time: 04, Nov, 2025 13:08

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	98,114
Registration No.	NHC8378	Chassis No.	PA1B18F33P4201274
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



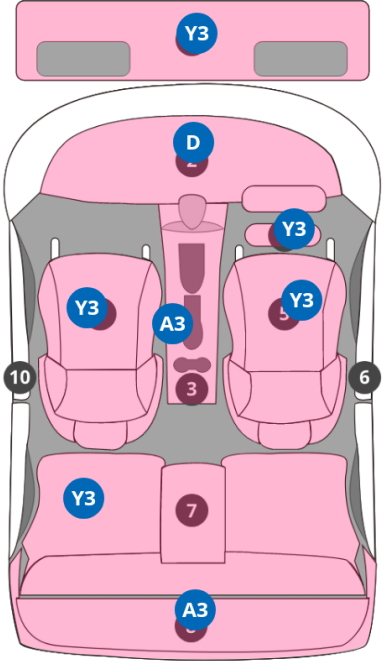
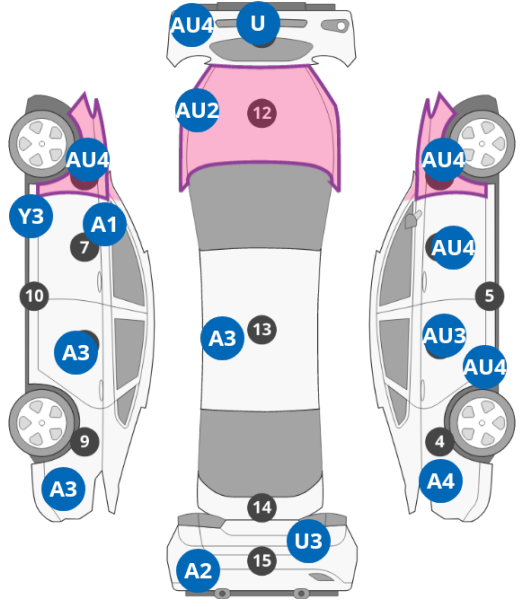
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	350.6	220	250	582
2	Boot Lid	98.8	93	100	104
3	Roof	86.8	90	84	85/88
4	Left Front Fender	410.6	367	362	503
5	Left Front Door	98.3	97	98	100
6	Center Panel Left				
7	Left Rear Door	98.3	110	94	91
8	Left Back Panel	103.9	109	104	99
9	Right Front Fender	227.3	193	166	323
10	Right Front Door	159.3	136	148	194
11	Center Panel Right				
12	Right Rear Door	92.6	90	90	99
13	Right Back Panel	97.7	92	96	105

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Crack, Gap - Medium / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Condition of Welding ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate/without spare tire/No jack & tools/ with spare key/ without warranty/ plate light issue & park light issue/ front doors issue</p>