

## General Information

Date & Time: 04, Nov, 2025 08:46

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	15,456
<b>Registration No.</b>	NHM8860	<b>Chassis No.</b>	MR0JB8DD4P3549866
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Gray		

## Body / Panel Condition



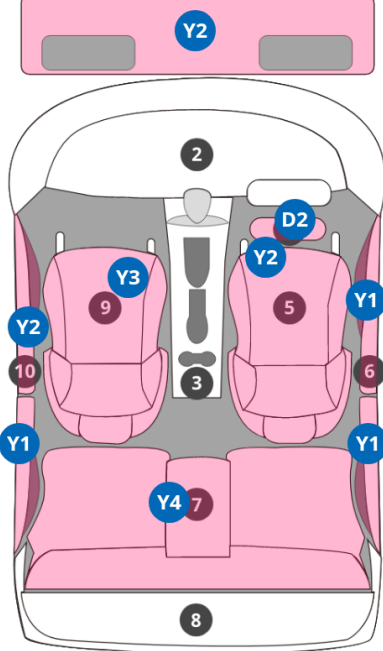
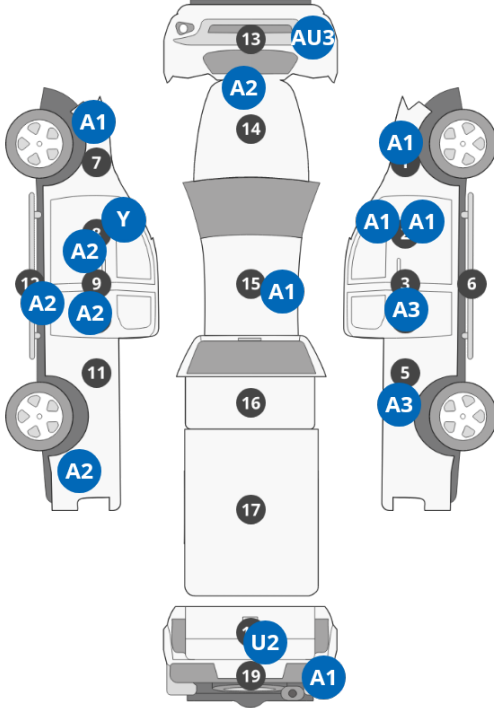
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.6	125	140	118
2	Boot Lid	101.1	105	93	105
3	Roof	124.5	122	138	115/123
4	Left Front Fender	111.3	113	111	110
5	Left Front Door	110.0	108	110	112
6	Center Panel Left				
7	Left Rear Door	102.4	107	98	102
8	Left Back Panel	121.3	111	125	128
9	Right Front Fender	114.0	108	121	113
10	Right Front Door	105.3	109	102	105
11	Center Panel Right				
12	Right Rear Door	99.2	95	99	104
13	Right Back Panel	117.0	129	107	115

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / Rear Gate - Dent - Small / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal / (L) Mirror - Crack - Damaged</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light</p>