

## General Information

Date & Time: 05, Nov, 2025 18:18

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	129,525
<b>Registration No.</b>	NHI6819	<b>Chassis No.</b>	PA1B18F30P4207761
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



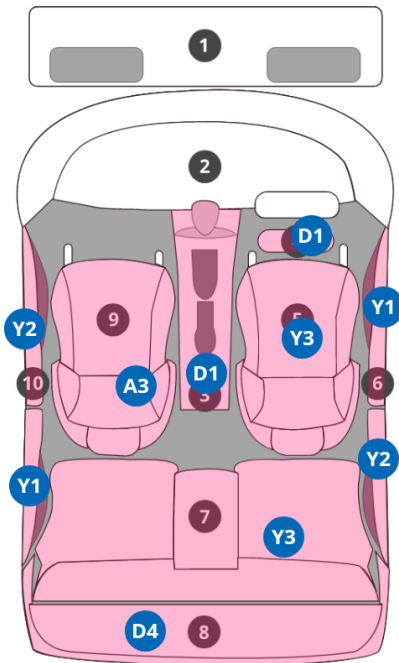
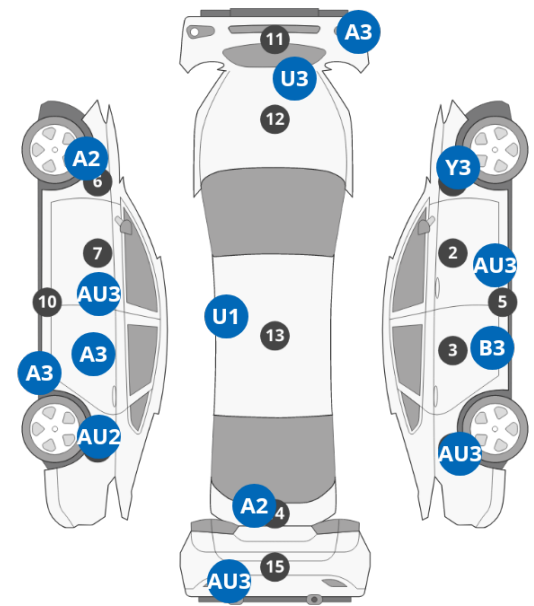
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	138.6	174	136	106
2	Boot Lid	116.3	111	109	129
3	Roof	100.0	104	100	103/93
4	Left Front Fender	98.0	95	100	99
5	Left Front Door	97.6	97	95	101
6	Center Panel Left				
7	Left Rear Door	100.6	105	98	99
8	Left Back Panel	107.5	107	100	116
9	Right Front Fender	135.6	116	131	160
10	Right Front Door	107.6	101	118	104
11	Center Panel Right				
12	Right Rear Door	115.0	138	104	103
13	Right Back Panel	132.0	106	134	156

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>          Carpet - Worked - Minimal / (R) Front Seat - Grime - Medium / (L) Front Seat - Cut, Crack - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / Trunk Room - Worked - Large / Console, Switchs, Vents - Worked - Minimal</p>	<p><b>Remarks</b>          (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Modified - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / Overall Exterior - Faded(Color, Gloss) - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Dent - Medium / Roof - Dent - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b>          Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b>          Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate,plate light issue,with jack and incomplete tools,with spare tire,with owner's manual but no warranty booklet, no back camera, unusual noise at engine bay area,</p>