

## General Information

Date & Time: 04, Nov, 2025 15:03

Make	Mitsubishi	Model	Mirage
YOM	2013	Odo Meter Reading	86,400
Registration No.	WFO822	Chassis No.	MMBXTA03ADH012479
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

## Body / Panel Condition



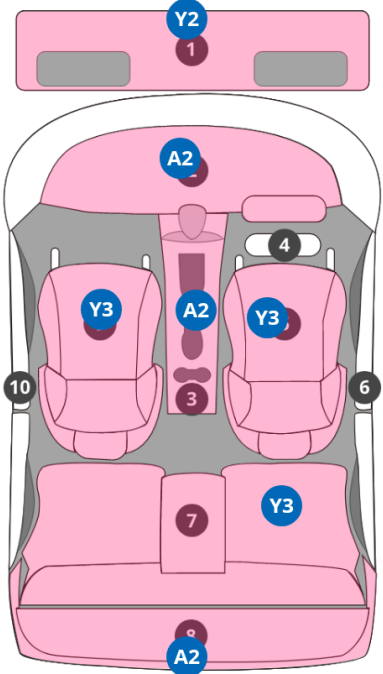
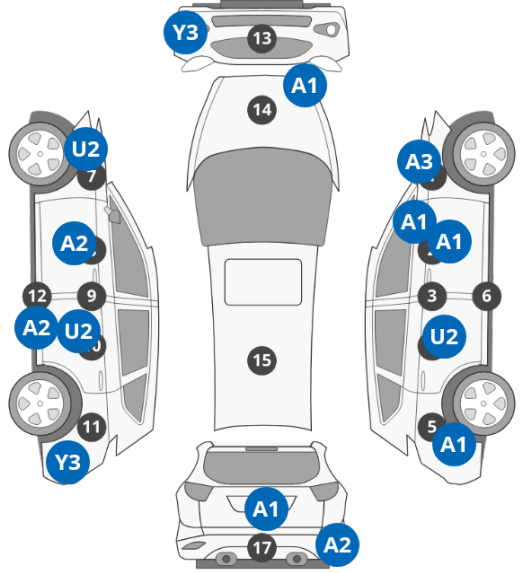
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	162.6	185	147	156
2	Boot Lid	170.3	187	152	172
3	Roof	126.5	131	119	127/129
4	Left Front Fender	181.0	158	199	186
5	Left Front Door	158.6	160	160	156
6	Center Panel Left				
7	Left Rear Door	163.0	172	162	155
8	Left Back Panel	148.6	157	161	128
9	Right Front Fender	212.6	185	268	185
10	Right Front Door	212.6	214	184	240
11	Center Panel Right				
12	Right Rear Door	216.3	212	185	252
13	Right Back Panel	224.6	171	180	323

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Dent - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Crack, Gap - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/front door driver side left issue &amp; squeaking sound, incomplete tools with jack, , right passenger side handle broken, no reverse camera, no fog lamps,plate light issue, rear seat issue,with service warranty booklet, unusual sound in the engine</p>