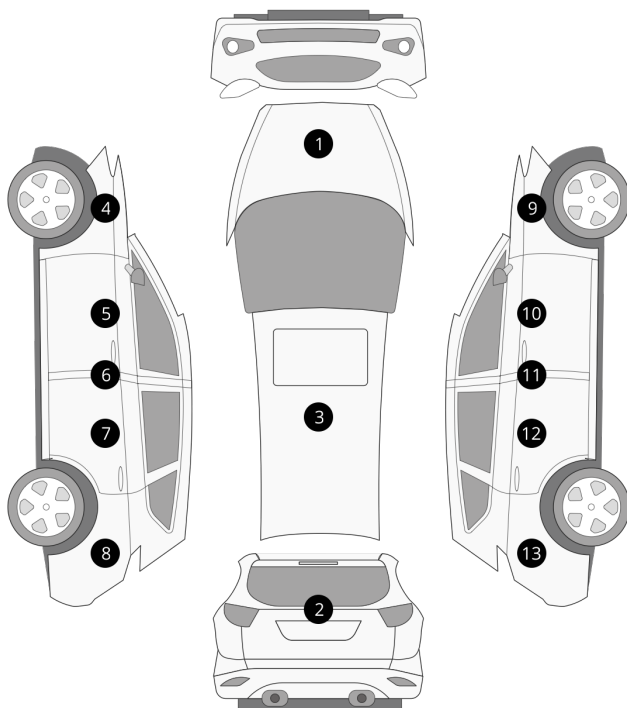


General Information

Date & Time: 12, Nov, 2025 17:31

Make	Toyota	Model	Avanza
YOM	2021	Odo Meter Reading	83,427
Registration No.	FAF7437	Chassis No.	MHKM5EF2FMK028140
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



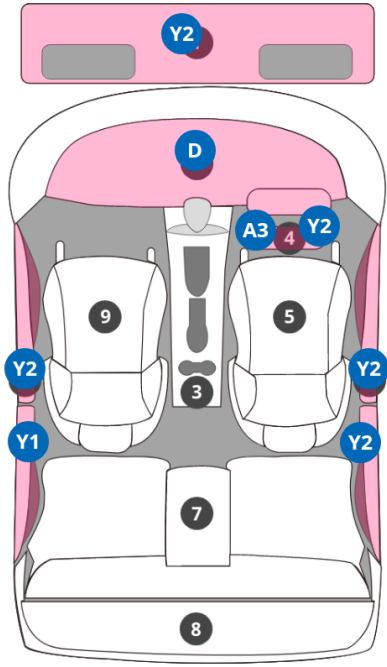
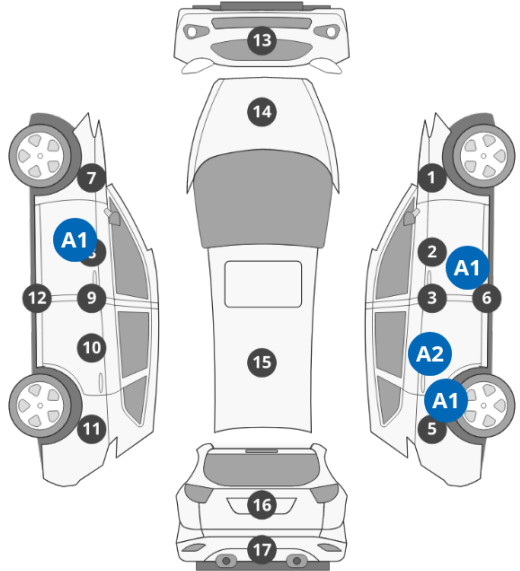
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	152.3	168	161	128
2	Boot Lid	142.6	128	154	146
3	Roof	132.2	132	117	152/128
4	Left Front Fender	133.3	138	132	130
5	Left Front Door	151.3	153	133	168
6	Center Panel Left				
7	Left Rear Door	170.3	178	190	143
8	Left Back Panel	161.3	174	150	160
9	Right Front Fender	226.6	253	234	193
10	Right Front Door	216.3	213	218	218
11	Center Panel Right				
12	Right Rear Door	177.6	178	178	177
13	Right Back Panel	322.0	194	200	572

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet,jack and tools. With spare tire and seat cover. 1 key. LTO plate not installed.