

General Information

Date & Time: 12, Nov, 2025 17:32

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2022 | Odo Meter Reading | 104,674 |
| Registration No. | FAI9605 | Chassis No. | PA1B18F33M4165257 |
| CC | 1.3 | Transmission | M/T |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Silver | | |

Body / Panel Condition



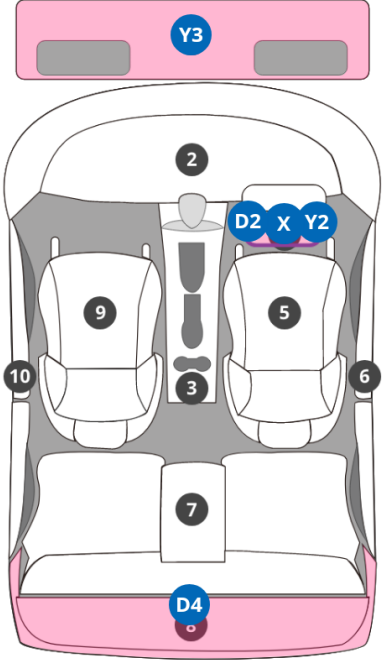
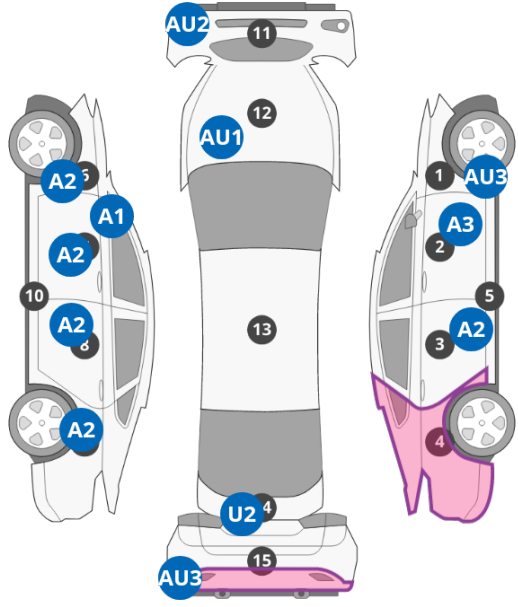
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 110.6 | 105 | 110 | 117 |
| 2 | Boot Lid | 101.5 | 105 | 99 | 101 |
| 3 | Roof | 93.1 | 104 | 86 | 87/97 |
| 4 | Left Front Fender | 92.2 | 99 | 90 | 87 |
| 5 | Left Front Door | 134.3 | 132 | 142 | 129 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 126.3 | 133 | 123 | 123 |
| 8 | Left Back Panel | 106.6 | 111 | 105 | 104 |
| 9 | Right Front Fender | 91.8 | 94 | 89 | 92 |
| 10 | Right Front Door | 95.0 | 100 | 94 | 91 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 92.3 | 90 | 89 | 98 |
| 13 | Right Back Panel | 102.0 | 100 | 100 | 106 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|--|--|
| Interior Evaluation : C | Exterior Evaluation : D |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks Ceiling - Grime - Medium / (R) Front Floor Mat - Grime - Small / Mat Other - Missing - Yes / (L) Front Floor Mat - Worked - Small / Trunk Room - Worked - Large</p> | <p>Remarks (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small</p> |
| Frame Evaluation : A | Functional Evaluation : B |
| <p>Remarks Defects not found</p> | <p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p> |

| |
|---|
| <p>Inspector Notes</p> |
| <p>Rear right fender repaired. Trunk floor partially missing. Possible flooding. Without warranty booklet and tools. With spare tire, jack and leather seat cover. 1 key. With LTO plate.</p> |