

## General Information

Date & Time: 05, Nov, 2025 10:23

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	42,935
<b>Registration No.</b>	NKE6023	<b>Chassis No.</b>	PA1B18F31R4265378
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



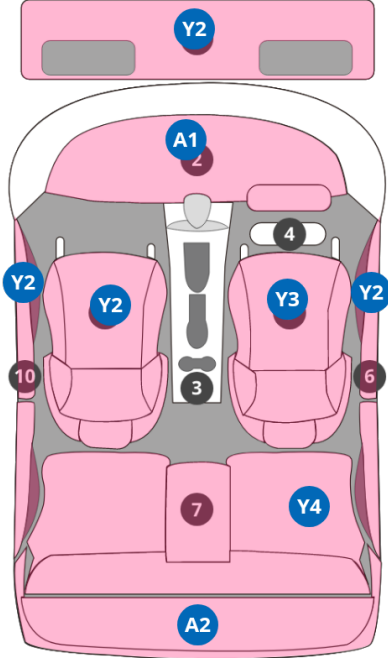
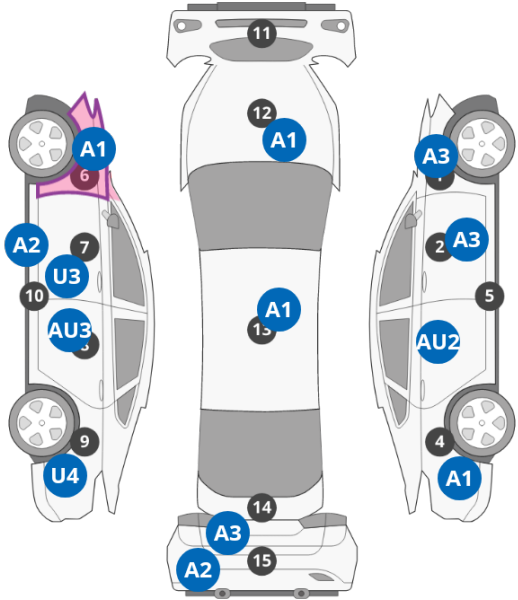
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	107	103	104
2	Boot Lid	102.4	95	104	108
3	Roof	98.2	104	93	95/101
4	Left Front Fender	629.0	1,144	262	481
5	Left Front Door	123.6	136	120	115
6	Center Panel Left				
7	Left Rear Door	99.2	100	99	100
8	Left Back Panel	115.6	116	127	104
9	Right Front Fender	102.0	104	99	103
10	Right Front Door	105.6	106	104	107
11	Center Panel Right				
12	Right Rear Door	103.4	99	101	110
13	Right Back Panel	102.6	90	107	111

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p><b>Remarks</b> (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (L) Front Door, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Dent - Large / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with jack and incomplete tools/with spare key/with reverse camera/with warranty booklet</p>