

General Information

Date & Time: 08, Nov, 2025 15:55

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	23,581
Registration No.	LAL2399	Chassis No.	PAEA13TJPNA002537
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



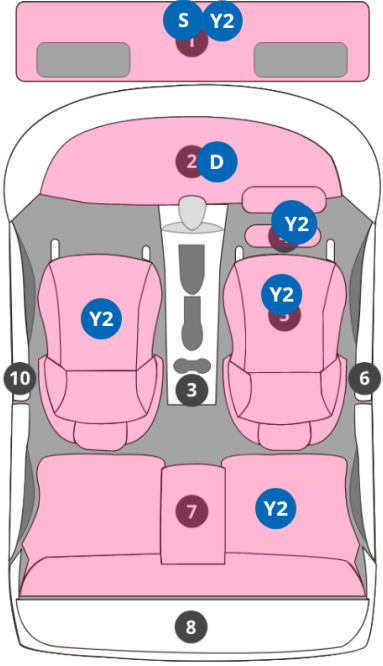
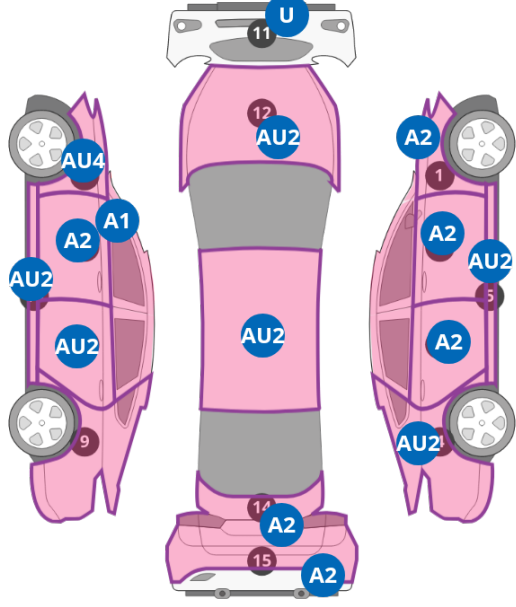
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	658.6	1,214	359	403
2	Boot Lid	290.6	283	257	332
3	Roof	459.5	334	242	1,015/247
4	Left Front Fender	615.6	999	326	522
5	Left Front Door	356.6	259	294	517
6	Center Panel Left				
7	Left Rear Door	263.0	259	281	249
8	Left Back Panel	421.0	300	213	750
9	Right Front Fender	858.0	644	902	1,028
10	Right Front Door	171.3	198	143	173
11	Center Panel Right				
12	Right Rear Door	288.0	431	203	230
13	Right Back Panel	731.6	887	739	569

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / Roof - Repair mark - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : D	Functional Evaluation : D
Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Condition of Welding ? - Yes	Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate in front and temporary plate in rear, with Jack, No Tools and Sparetire, No spare key, no reverse camera, foul smell, possible flooded, warning lamps on, worn tires, adhesive marks on vehicle.