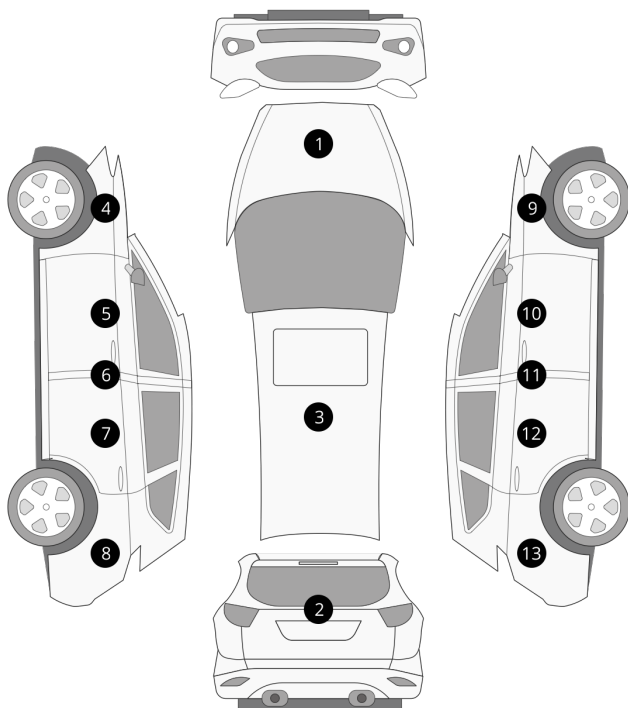


General Information

Date & Time: 10, Nov, 2025 17:01

Make	Suzuki	Model	Ertiga
YOM	2016	Odo Meter Reading	61,139
Registration No.	FDM7368	Chassis No.	MHYZE8153HJ301225
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	White		

Body / Panel Condition



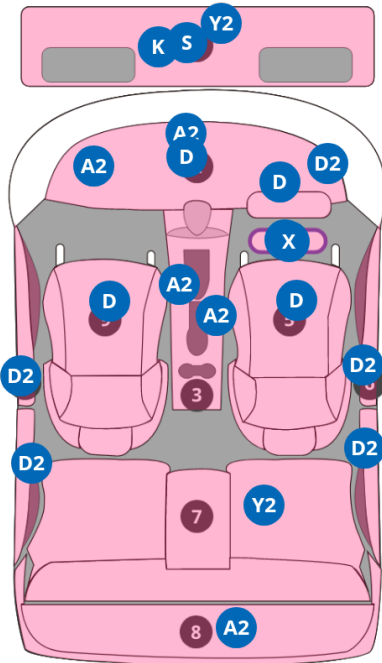
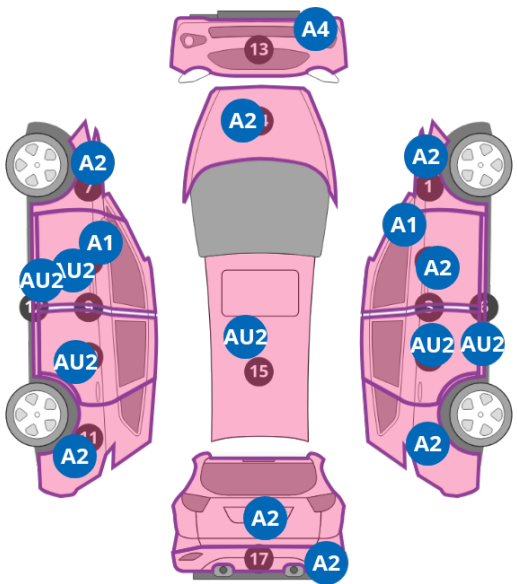
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	276.0	263	263	302
2	Boot Lid	254.3	264	181	318
3	Roof	234.7	223	261	324/131
4	Left Front Fender	209.0	174	251	202
5	Left Front Door	223.6	179	225	267
6	Center Panel Left				
7	Left Rear Door	205.0	180	215	220
8	Left Back Panel	264.3	261	306	226
9	Right Front Fender	228.0	163	219	302
10	Right Front Door	154.3	239	108	116
11	Center Panel Right				
12	Right Rear Door	199.3	188	197	213
13	Right Back Panel	192.6	163	217	198

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small / (L) Front Trim - Loose, Deformed - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Rear Seat - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Knobs - Worn, Peel, Crack - Small / Display, Audio System - Stuck - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Loose, Deformed - Small / Glove Box - Traces of Adhesive Tape - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Trim - Loose, Deformed - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Step - Replaced - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Replaced - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Replaced - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Condition of Welding ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch and crack tail light and headlight, worn tires and Sparetire, No spare key, no reverse camera, foul smell, possible flooded, warning lamps on, headlight worn and tail light worn, adhesive marks on vehicle.