

General Information

Date & Time: 11, Nov, 2025 17:36

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2023 | Odo Meter Reading | 31,035 |
| Registration No. | DBH8635 | Chassis No. | PA1B18F37P4209653 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Red | | |

Body / Panel Condition



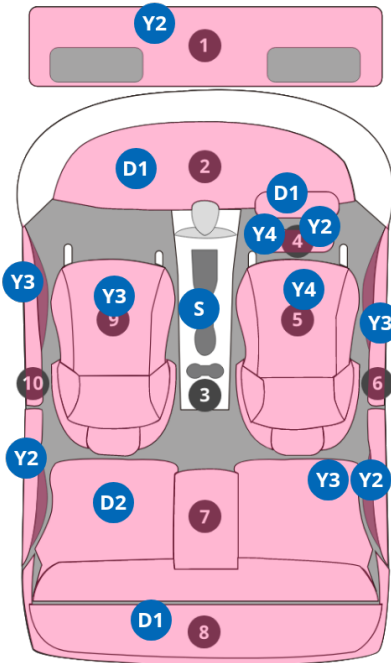
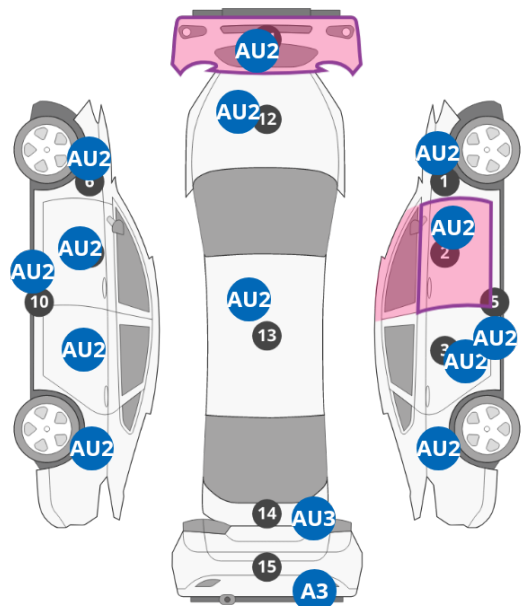
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 107.5 | 103 | 98 | 122 |
| 2 | Boot Lid | 501.0 | 333 | 932 | 238 |
| 3 | Roof | 99.1 | 101 | 90 | 98/108 |
| 4 | Left Front Fender | 109.2 | 110 | 100 | 118 |
| 5 | Left Front Door | 109.0 | 111 | 107 | 109 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 110.3 | 120 | 110 | 101 |
| 8 | Left Back Panel | 111.3 | 118 | 111 | 105 |
| 9 | Right Front Fender | 106.0 | 105 | 109 | 104 |
| 10 | Right Front Door | 101.4 | 102 | 105 | 97 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 103.6 | 103 | 102 | 106 |
| 13 | Right Back Panel | 99.8 | 97 | 100 | 103 |

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|--|
| Interior Evaluation : E | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Large / Dashboard - Worked - Minimal / (L) Rear Trim - Grime - Small / Trunk Room - Worked - Minimal / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Small / Glove Box - Worked - Minimal / Overall Interior - Smell - Yes / Rear Seat Head Rest - Worked - Small</p> | <p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Overall Exterior - Full Re-Paint in same color - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small</p> |
| Frame Evaluation : B | Functional Evaluation : A |
| <p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p> | <p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p> |

| |
|---|
| <p>Inspector Notes</p> |
| <p>with LTO plate, No manual & warranty booklet, no spare key, no tools, with jack, with taillight scratches, no back camera, possible flooded.</p> |